DISCOVERING AutoCAD® 2027



MARK DIX
PAUL RILEY
KADE KING

FREE SAMPLE CHAPTER |

Discovering AutoCAD® 2027

Mark Dix

Paul Riley

KaDe King



Discovering AutoCAD® 2027

Copyright © 2027 by Pearson Education, Inc., Hoboken, New Jersey. All rights reserved. This publication is protected by copyright, and permission should be obtained from the publisher prior to any prohibited reproduction, storage in a retrieval system, or transmission in any form or by any means, electronic, mechanical, photocopying, recording, or likewise. For information regarding permissions, request forms and the appropriate contacts within the Pearson Education Global Rights & Permissions Department, please visit https://www.pearson.com/global-permission-granting.html.

Many of the designations by manufacturers and sellers to distinguish their products are claimed as trademarks. Where those designations appear in this book, and the publisher was aware of a trademark claim, the designations have been printed in initial caps or all caps.

Autodesk screen shots reprinted courtesy of Autodesk, Inc. © 2026. All rights reserved. Autodesk, AutoCAD, Revit, DWG, and the DWG logo are registered trademarks of Autodesk, Inc., in the U.S.A. and certain other countries.

Many of the designations by manufacturers and seller to distinguish their products are claimed as trademarks. Where those designations appear in this book, and the publisher was aware of a trademark claim, the designations have been printed in initial caps or all caps.

Notice of Liability

The publication is designed to provide tutorial information about AutoCAD® and/or other Autodesk computer programs. Every effort has been made to make this publication complete and as accurate as possible. The reader is expressly cautioned to use any and all precautions necessary, and to take appropriate steps to avoid hazards, when engaging in the activities described herein.

Neither the authors nor the publisher makes any representations or warranties of any kind, with respect to the materials set forth in this publication, express or implied, including without limitation any warranties of fitness for a particular purpose or merchantability. Nor shall the author or the publisher be liable for any special, consequential or exemplary damages resulting, in whole or in part, directly or indirectly, from the reader's use of, or reliance upon, this material or subsequent revisions of this material.

Credits and acknowledgments borrowed from other sources and reproduced, with permission, in this textbook appear on appropriate page within text.

Acquisitions Editor: Anshul Sharma
Managing Editor: Sandra Schroeder
Project Editor: Charlotte Kughen
Cover Designer: Chuti Prasertsith
Cover Image: darkhairedblond/Adobe Stock
Composition: Bronkella Publishing, LLC
Indexer: Johnna VanHoose Dinse
Proofreader: Rick Kughen
Graphics: tj graham art

Library of Congress Control Number: 2026952427

ISBN 10: 0-13-557165-0
ISBN 13: 978-0-13-557165-1

$PrintCode



Preface

Get Active with *Discovering AutoCAD® 2027*

Designed for introductory AutoCAD users, *Discovering AutoCAD 2027* offers a hands-on, activity-based approach to the use of AutoCAD as a drafting tool—complete with techniques, tips, shortcuts, and insights designed to increase efficiency. Topics and tasks are carefully grouped to lead you logically through the AutoCAD command set, with the level of difficulty increasing steadily as you acquire skills through experience and practice. Straightforward explanations focus on what is relevant to actual drawing procedures, and illustrations show exactly what to expect on the computer screen when you correctly complete steps. Each chapter ends with drawing exercises that assess and reinforce your understanding of the material.

Features

The book uses a consistent format for each chapter that includes the following:

- Chapter Objectives and Introduction
- Exercises that introduce new commands and techniques
- Exercise instructions clearly set off from the text discussion
- Lots of illustrations with drawings and screenshots
- Twenty end-of-chapter Review Questions
- Four to eight realistic engineering drawing problems—fully dimensioned working drawings

High-quality working drawings include a wide range of applications that focus on mechanical drawings but also include architectural, civil, plumbing, general, and electrical drawings. Appendix A contains 21 drawing projects for additional review and practice. Appendixes B, C, and D cover material not required for drawing practice but highly relevant for any beginning CAD professional. These include information on customization features, basic programming procedures, and a summary of Autodesk cloud-based and file-sharing features.

Acknowledgments

The authors thank the following reviewers for their feedback: John Irwin, Michigan Technological University; Tony Graham, North Carolina A&T State University; Beverly Jaeger, Northeastern University; Daniel McCall, Amarillo College; and Susan Freeman, Northeastern University. Lastly, we would like to thank Jon Page (and his family) for his time in reviewing the content changes made in this edition of the book.

Features New to This Edition

1. Updated to reflect the latest changes to AutoCAD with the 2027 release
2. Updated illustrations representing the newest AutoCAD interface

Style Conventions in *Discovering AutoCAD® 2027*

Text Element	Example
Key terms—Boldface and italic on first mention (first letter lowercase, as it appears in the body of the text). Brief definition in margin alongside first mention. Full definition in Glossary available at peachpit.com/Discoverautocad2027.	Views are created by placing ***viewport*** objects in the paper space layout.
AutoCAD commands—Bold and uppercase.	Start the **LINE** command.
Ribbon and panel names, palette names, toolbar names, menu items, and dialog box names—Bold and follow capitalization convention in AutoCAD toolbar or pull-down menu. (Generally, the first letter is capitalized.)	The **Layer Properties Manager** palette
Panel tools, toolbar buttons, and dialog box controls/buttons/input items—Bold and follow the name of the item or the name shown in the AutoCAD tooltip.	Choose the **Line** tool from the **Draw** panel. Choose the **Symbols and Arrows** tab in the **Modify Dimension Style** dialog box. Choose the **New Layer** button in the **Layer Properties Manager** palette. In the **Lines and Arrows** tab, set the **Arrow size:** to **.125.**
AutoCAD prompts—Dynamic input prompts are set in a different font to distinguish them from the text. Command-line prompts are set to look like the text in the command line, including capitalization, brackets, and punctuation. Text following the prompt's colon specifies user input in bold.	*AutoCAD prompts you to specify first point:* `Specify center point for circle or [3P 2P Ttr (tan tan radius)]: 3.5`
Keyboard input—Bold with special keys in brackets.	Type **3.5 <Enter>**.

Download Instructor Resources from the Instructor Resource Center

Instructor materials are available from Pearson's Instructor Resource Center. Go to **https://www.pearson.com/en-us/highered-educators.html** to register or to sign in if you already have an account.

Contents

Part One Basic Two-Dimensional Entities

Chapter 1 Lines and Essential Tools 1
- Chapter Objectives 1
- Introduction 1
- Getting Started and Creating a New Drawing 2
- Exploring the Application and Drawing Window 4
- Interacting with the Drawing Window 7
- Exploring Command Entry Methods 12
- Drawing, Undoing, and Erasing Lines 19
- Saving and Opening Your Drawings 31
- Getting Started 32
  - Chapter Summary 36
  - Chapter Test Questions 36
  - Chapter Drawing Projects 38

Chapter 2 Circles and Drawing Aids 51
- Chapter Objectives 51
- Introduction 51
- Changing the Grid Setting 52
- Changing the Snap Setting 53
- Changing Units 55
- Drawing Circles by Specifying a Center Point and a Diameter 60
- Accessing AutoCAD Online Help Features 63
- Using Single-Point Object Snap 75
- Customizing Your Workspace 79
- Plotting or Printing a Drawing 80
  - Chapter Summary 85
  - Chapter Test Questions 85
  - Chapter Drawing Projects 88

Chapter 3 Layers, Colors, and Linetypes 101
- Chapter Objectives 101
- Introduction 101
- Assigning Colors to Layers 104
- Assigning Linetypes 106
- Assigning Lineweights 108
- Changing the Current Layer 109
- Changing Linetype Scale 111
- Editing Corners Using FILLET 112
- Zooming and Panning with the Scroll Wheel 117
- Using the ZOOM Command 118
- Entering Single-Line Text 122
  - Chapter Summary 124
  - Chapter Test Questions 124
  - Chapter Drawing Projects 126
  - 3D Models of Multiple-View Drawings 128

Chapter 4 Templates, Copies, and Arrays 139
- Chapter Objectives 139
- Introduction 139
- Setting Drawing Limits 140
- Creating a Drawing Template 143
- Saving a Drawing Template 144
- Using the MOVE Command 146
- Using the COPY Command 150
- Using the ARRAYRECT Command—Rectangular Arrays 154
- Creating Center Marks 160
- Changing Plot Settings 161
  - Chapter Summary 165
  - Chapter Test Questions 165
  - Chapter Drawing Projects 168

Chapter 5 Arcs and Polar Arrays 183
- Chapter Objectives 183
- Introduction 183
- Creating Polar Arrays 183
- Using the ROTATE Command 193
- Using Polar Tracking at Any Angle 196
- Creating Mirror Images of Objects 198
- Creating Page Setups 202
  - Chapter Summary 207
  - Chapter Test Questions 207
  - Chapter Drawing Projects 210

Chapter 6 Object Snaps and Resized Objects 223
Chapter Objectives 223
Introduction 223
Selecting Points with Object Snap (Single-Point Override) 224
Selecting Points with Running Object Snaps 226
Object Snap Tracking 230
Using the OFFSET Command (Creating Parallel Objects with OFFSET) 235
Shortening Objects with the TRIM Command 237
Extending Objects with the EXTEND Command 240
Using STRETCH to Alter Objects Connected to Other Objects 242
Measuring Objects 248
Creating Plot Layouts 251
Chapter Summary 262
Chapter Test Questions 262
Chapter Drawing Projects 264

Part Two Text, Dimensions, and Other Complex Entities

Chapter 7 Text 279
Chapter Objectives 279
Introduction 279
Entering Single-Line Text with Justification Options 279
Entering Text on an Angle and Text Using Character Codes 286
Entering Multiline Text Using MTEXT 288
Editing Text in Place with TEXTEDIT 290
Modifying Text with the Quick Properties Palette 291
Using the SPELL and FIND Commands 294
Changing Fonts and Styles 296
Changing Properties with MATCHPROP 300
Scaling Previously Drawn Entities 302
Creating Tables and Fields 305
Using Drawing Templates, Borders, and Title Blocks 311
Chapter Summary 314
Chapter Test Questions 314
Chapter Drawing Projects 316

Chapter 8 Dimensions 329
Chapter Objectives 329
Introduction 329
Creating and Saving a Dimension Style 329
Drawing Linear Dimensions 334
Drawing Multiple Linear Dimensions Using QDIM 339
Drawing Ordinate Dimensions 342
Drawing Angular Dimensions 347
Dimensioning Arcs and Circles 350
Annotating with Multileaders 352
Changing Dimension Text 359
Using Associative Dimensions 361
Using the HATCH Command 364
Scaling Dimensions Between Paper Space and Model Space 369
Chapter Summary 380
Chapter Test Questions 380
Chapter Drawing Projects 382

Chapter 9 Polylines 399
Chapter Objectives 399
Introduction 399
Drawing Polygons 400
Drawing Donuts 402
Using the FILL Command 404
Drawing Straight Polyline Segments 405
Drawing Polyline Arc Segments 408
Editing Polylines with PEDIT 411
Drawing Splines 414
Creating Path Arrays 416
Drawing Revision Clouds 418
Drawing Points 421
Using Constraint Parameters 423
Using AutoConstrain and Inferred Constraints 431
Chapter Summary 435
Chapter Test Questions 435
Chapter Drawing Projects 438

Chapter 10 Blocks, Attributes, and External References 453
Chapter Objectives 453
Introduction 453

Creating Groups 454
Creating Blocks 456
Inserting Blocks into the Current Drawing 460
Creating Dynamic Blocks 464
Adding Constraints to Dynamic Blocks 472
Accessing Data in a Block Table 475
Using the Windows Clipboard 479
Inserting Blocks and External References into Other Drawings 483
Using AutoCAD DesignCenter 487
Defining Attributes 494
Working with External References 500
Extracting Data from Attributes 503
Counting Blocks 507
Replacing Blocks 509
Automatic Block Conversion 509
Automatic Block Detection 510
Creating Tool Palettes 510
Exploding Blocks 511
Chapter Summary 513
Chapter Test Questions 513
Chapter Drawing Projects 516

Part Three Isometric Drawing and Three-Dimensional Modeling

Chapter 11 Isometric Drawing 525
Chapter Objectives 525
Introduction 525
Using Isometric Snap 525
Switching Isometric Planes 527
Using COPY and Other Edit Commands 529
Drawing Isometric Circles with ELLIPSE 532
Drawing Text Aligned with Isometric Planes 535
Drawing Ellipses in Orthographic Views 538
Saving and Restoring Displays with VIEW 541
Chapter Summary 545
Chapter Test Questions 545
Chapter Drawing Projects 548

Chapter 12 3D Modeling 563
Chapter Objectives 563
Introduction 563
Creating and Viewing a 3D Wireframe Box 564
Defining User Coordinate Systems 570
Exploring the 3D Basics Workspace 575
Creating Solid Boxes and Wedges 576
Accessing Different Visual Styles 580
Creating the Union of Two Solids 581
Working with DUCS 582
Creating Composite Solids with SUBTRACT 585
Creating Chamfers and Fillets on Solid Objects 591
Practicing 3D Gizmo Editing 595
Rendering 3D Models 597
Changing Viewpoints with the ViewCube 613
Creating Layouts with Multiple Views 615
Chapter Summary 620
Chapter Test Questions 620
Chapter Drawing Projects 622

Chapter 13 More Modeling Techniques and Commands 631
Chapter Objectives 631
Introduction 631
Drawing Polysolids 632
Drawing Cones 636
Drawing Pyramids 638
Drawing Torus 639
Slicing and Sectioning Solids 640
Mesh Modeling 645
Adjusting Viewpoints with 3DORBIT 657
Creating 3D Solids from 2D Outlines 665
Walking Through a 3D Landscape 672
Creating an Animated Walk-Through 675
Chapter Summary 680
Chapter Test Questions 680
Chapter Drawing Projects 682

Appendix A Drawing Projects 695

Appendix B Creating Custom Ribbon Panels 717

Creating a Customized Ribbon Panel 718

Creating Customized Tools 721

Appendix C Menus, Macros, and the CUI Dialog Box 729

The CUI Dialog Box 729

Characters Used in Menus and Macros 733

Index 735

Appendix D and Glossary are available online at peachpit.com/register.

Appendix D (Online only)
Additional Tools for Collaboration

Glossary (Online only)

11 chapter eleven

Isometric Drawing

CHAPTER OBJECTIVES

- Use isometric snap
- Switch isometric planes
- Use **COPY** and other edit commands
- Draw isometric circles with **ELLIPSE**
- Draw text aligned with isometric planes
- Draw ellipses in orthographic views
- Save and restore displays with **VIEW**

Introduction

Learning to create isometric drawings should be a pleasure at this point. There are very few new commands to learn, and anything you already know about manual isometric drawing makes it that much easier on the computer. Once you know how to get into the isometric mode in AutoCAD and change from plane to plane, you can rely on previously learned skills and techniques. Many of the commands from early chapters in this book will work readily, and you will find that using the isometric drawing planes is an excellent warm-up for 3D wireframe and solid modeling.

Using Isometric Snap

To begin drawing isometrically, you need to switch to the isometric snap style. You will find the grid and crosshairs behaving in ways that might seem odd at first, but you will quickly get used to them.

TIP

The following is a general procedure for entering isometric snap mode:

1. Click the **ISODRAFT** tool from the status bar.
2. Press **<F5>** to cycle through the three isoplanes.

✔ Begin a new drawing using decimal units and 18 × 12 limits. Use the *1B* template if you have it; otherwise, be sure to use the *acad.dwt* template.

✔ Check to see that the **Grid Mode** and **Snap Mode** tools are on.

✔ Click the **ISODRAFT** tool from the status bar, as shown in Figure 11-1.

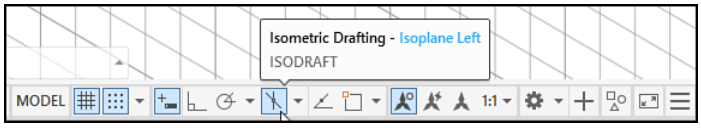


Figure 11-1
ISODRAFT tool

NOTE

Because isoplane settings are retained within the current session, it's possible that your crosshairs may be turned to the top or right isoplane instead of the left, as shown. It isn't necessary to change the setting in this exercise.

At this point, your grid and crosshairs are reoriented, resembling Figure 11-2. This is the 2D model space grid in isometric mode. Gridlines are drawn at 30°, 90°, and 150° angles from the horizontal, depending on which isoplane is being represented. The crosshairs are initially turned to define the left isometric plane, and gridlines are drawn to represent the left isoplane, with lines at 90° and 150°. The three ***isoplanes*** *are discussed in the "Switching Isometric Planes" section.*

isoplane: One of three planes used for isometric drawing. In AutoCAD, these planes are named left, right, and top.

✔ To get a feeling for how this snap style works, start the **LINE** command and draw some boxes, as shown in Figure 11-3.

Make sure ***Ortho*** *is off and* ***Snap*** *is on, or you will be unable to draw the lines shown.*

Figure 11-2
Isometric grid, left isoplane


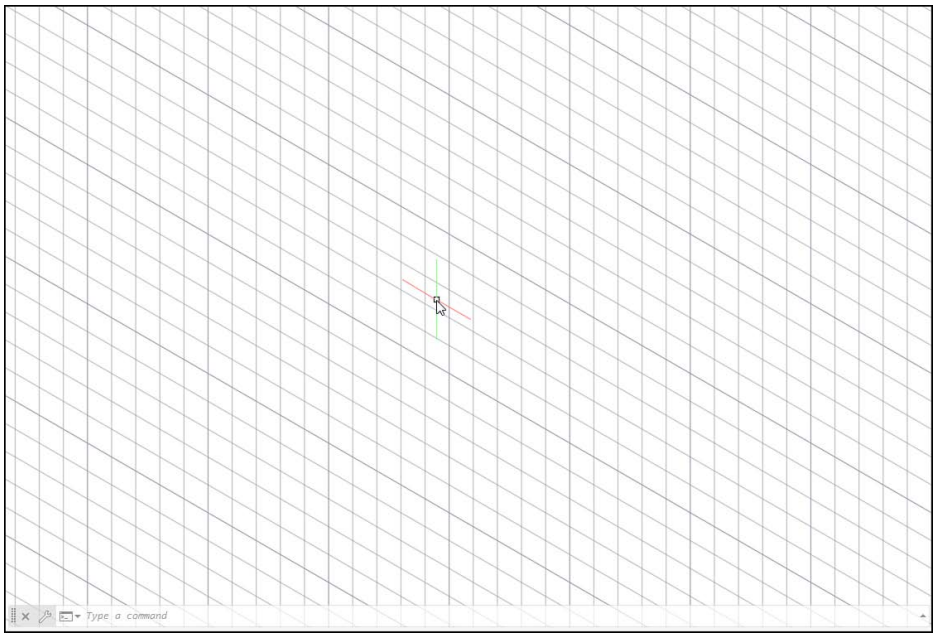


Figure 11-3
Isometric boxes

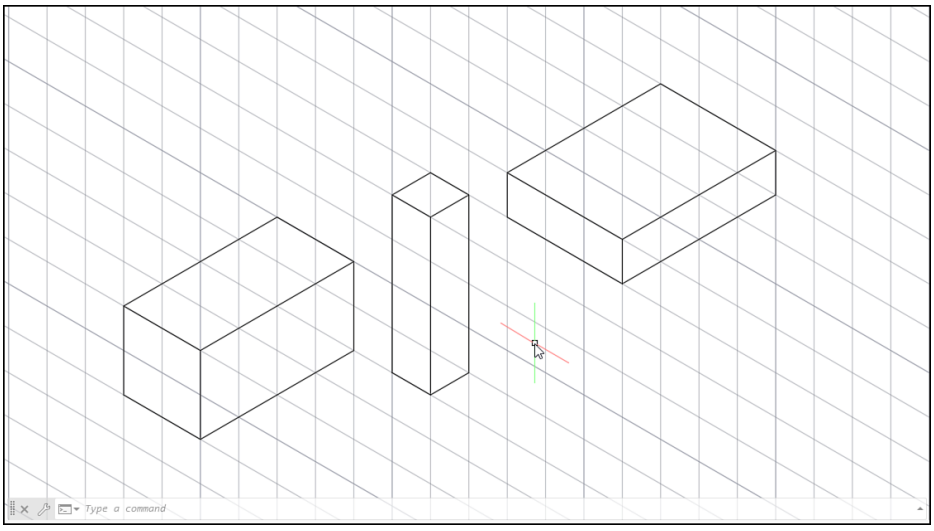


Switching Isometric Planes

If you tried to draw the boxes in the preceding section with **Ortho** on, you discovered that it is impossible. Without changing the orientation of the crosshairs, you can draw in only two of the three isometric planes. To utilize **Ortho** for accuracy and speed, you have to be able to switch planes. There are several ways to do this, but the simplest, quickest, and most convenient way is to use the **<F5>** key (or **<Ctrl>+E**).


Before beginning, take a look at Figure 11-4, which shows the three planes of a standard isometric drawing. These planes are often referred to as top, front, and right. However, AutoCAD's terminology is top, left, and right. While there are differences in the naming of the isometric planes, in this chapter, the AutoCAD terminology is used when referring to the isometric planes.

Figure 11-4
Isometric planes

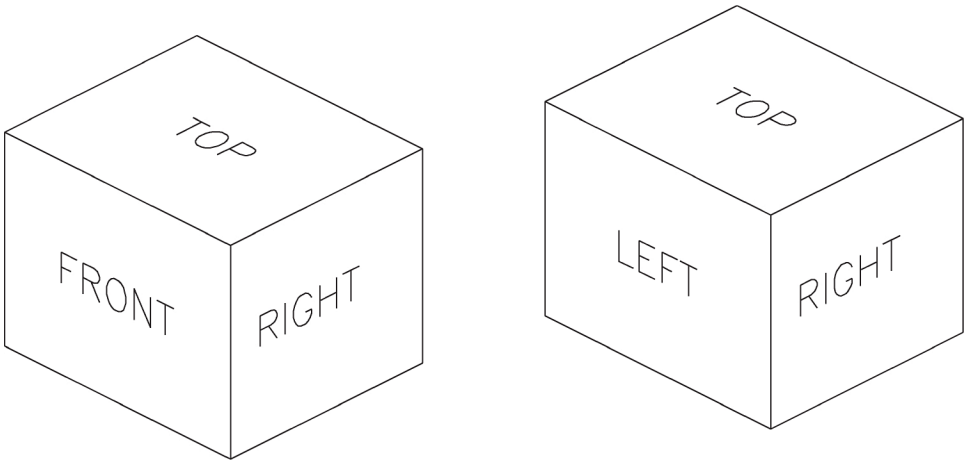


Now look at Figure 11-5. You can see how the isometric crosshairs are oriented to draw in each of the planes. The gridlines change for each isoplane as well. They will be at 90° and 150° for the left isoplane, 30° and 150° for the top isoplane, and 30° and 90° for the right isoplane.

Figure 11-5
Isometric crosshairs

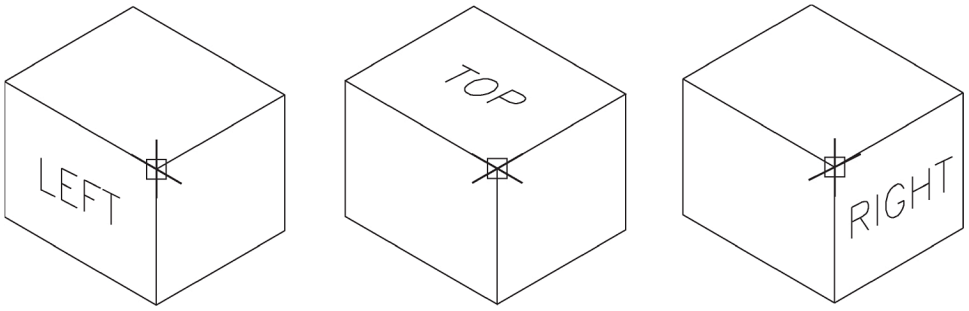

- ✔ Press **<F5>** (or **<Ctrl>**+**E**) to switch from left to top.
  You can also open the Isoplane drop-down menu to the right of the ***ISODRAFT*** *tool on the status bar to switch among the planes. The advantage of* ***<F5>*** *is that you can switch while drawing without moving your cursor away from the object you're drawing.*
- ✔ Press **<F5>** again to switch from top to right.
- ✔ Press **<F5>** once more to switch back to left.
- ✔ Now turn **Ortho** on and draw a box outline like the one in Figure 11-6.
  You need to switch planes several times to accomplish this. Notice that you can switch planes using ***<F5>*** *without interrupting the* ***LINE*** *command. If you find that you are in the wrong plane to construct a line, switch planes. Because every plane allows movement in two of the three directions, you can always move in the direction you want with one switch. However, you may not be able to hit the snap point you want. If you can't, switch planes again.*

Figure 11-6
Isometric box outline

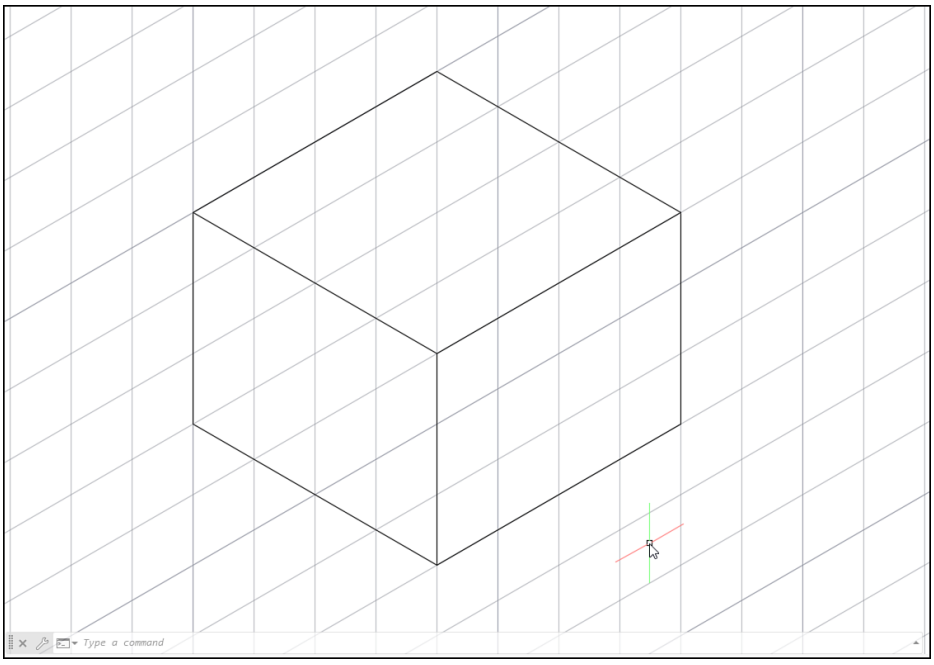


Using COPY and Other Edit Commands

Most commands work in the isometric planes just as they do in standard orthographic views. In this exercise, you construct an isometric view of a bracket using **LINE** and **COPY**. Then you draw angled corners using **CHAMFER**. In the next exercise, you'll draw a hole in the bracket with **ELLIPSE**, **COPY**, and **TRIM**.

- ✔ Erase the boxes you previously drew and check to see that **Ortho** mode is on.
- ✔ Switch to the left isoplane.
- ✔ Click the **Line** tool on the ribbon.
- ✔ Draw the L-shaped object shown in Figure 11-7.
  Notice that this is drawn in the left isoplane and that it's 3.00 units high by 4.00 units long by 1.00 unit wide.
- ✔ Next, you copy this object 4.00 units back to the right to create the back surface of the bracket.
- ✔ Click the **Copy** tool on the ribbon.
- ✔ Select all the lines in the L.
- ✔ Right-click to end object selection.
- ✔ Specify a base point at the inside corner of the L.
  *It's a good exercise to keep **Ortho** on, switch planes, and move the object around in each plane. You can move in two directions in each isoplane. To copy the object back to the right, as shown in Figure 11-8, you must be in either the top or the right isoplane.*

Figure 11-7
Drawing an L shape

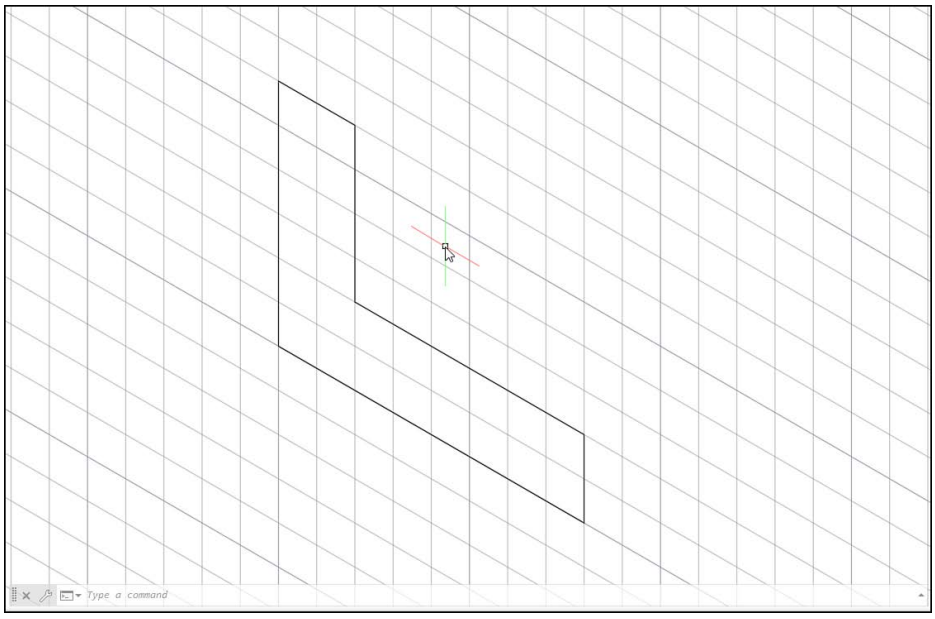

- ✔ Switch to the top or right isoplane and specify a second point of displacement 4.00 units back to the right, as shown in Figure 11-8.
- ✔ Press **<Enter>** to exit **COPY**.
- ✔ Enter the **LINE** command again and draw the connecting lines in the right plane, as shown in Figure 11-9.

Figure 11-8
Copying the L shape


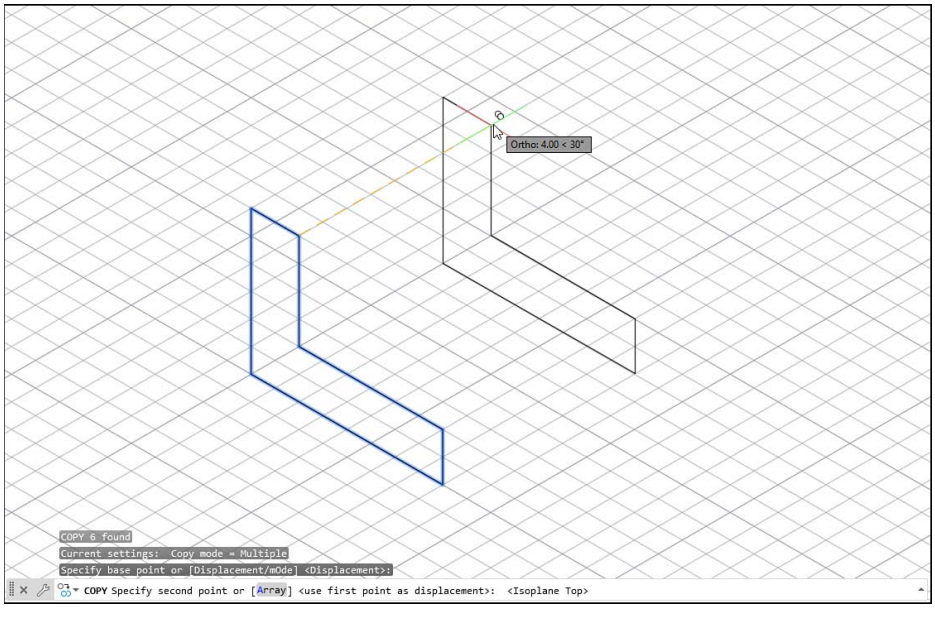


Figure 11-9
Drawing connecting lines

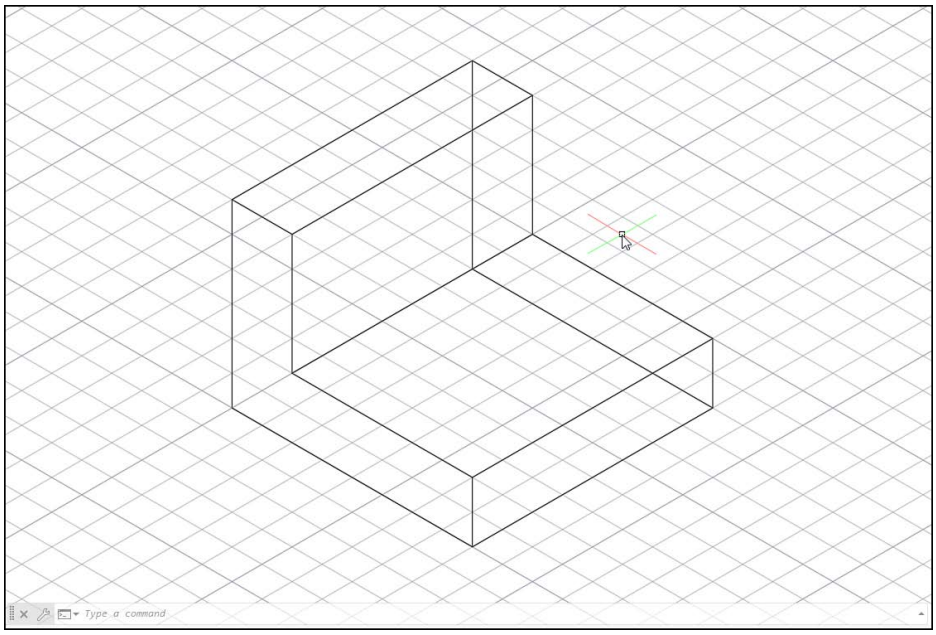

Creating Chamfers in an Isometric View

Keep in mind that inclined edges in an isometric view do not show true lengths. Edges of inclined planes must be drawn between endpoints located along vertical or horizontal paths in one of the three drawing planes. In this exercise, you create inclined edges by using the **CHAMFER** command to cut the corners of the bracket. This is no different from using **CHAMFER** in orthographic views.

- ✔ Click the **Chamfer** tool from the **Fillet/Chamfer** drop-down menu on the **Modify** panel on the ribbon's **Home** tab.
- ✔ Right-click and select **Distance** from the shortcut menu.
  AutoCAD prompts for a first chamfer distance.
- ✔ Type **1 <Enter>**.
- ✔ Press **<Enter>** to accept 1.00 as the second chamfer distance.
- ✔ Select the top and left back edges of the bracket to create a chamfer, as shown in Figure 11-10.
- ✔ Repeat the **CHAMFER** command.
- ✔ Chamfer the other edges so that your drawing resembles Figure 11-10.
- ✔ To complete the bracket, start the **LINE** command and draw lines between the new chamfer edges.
- ✔ Finally, erase the two unseen lines on the back surface and the two corner lines left "in space" from the creation of the chamfers to produce what's shown in Figure 11-11.

Figure 11-10
Chamfering corners


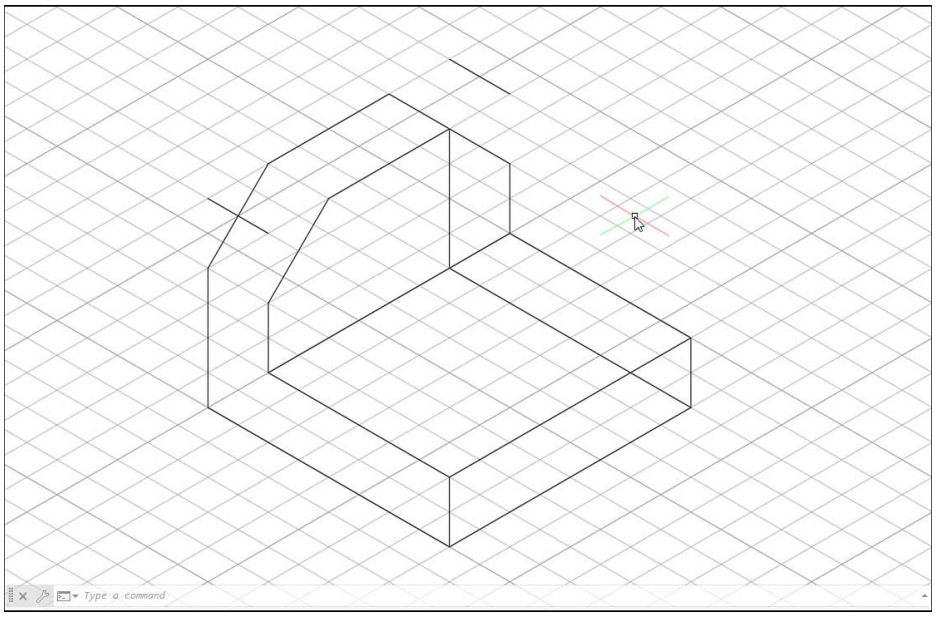


Figure 11-11
Finishing the chamfers and edges

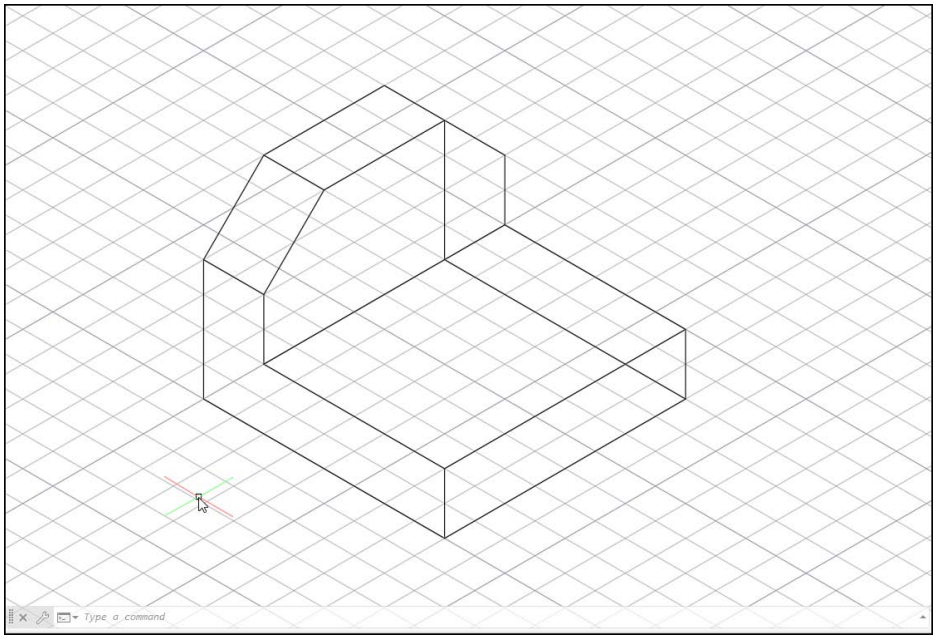

ELLIPSE	
Command	ELLIPSE
Alias	EI
Panel	Draw
Tool	

isocircle: The elliptical representation of a circle in an isometric drawing.

Drawing Isometric Circles with ELLIPSE

You can use the **ELLIPSE** command to draw true ellipses in orthographic views or ellipses that appear to be circles in isometric views (called ***isocircles*** in AutoCAD). In this exercise, you use the latter capability to construct a hole in the bracket.

✔ To begin, you should have the bracket shown in Figure 11-11 in your drawing.

To draw an isocircle, you need a center point. Often, it is necessary to locate this point carefully using temporary lines, object snap track-

*ing, or point filters. You must be sure that you can locate the center point before entering the **ELLIPSE** command.*

In this case, it's easy because the center point is on a snap point.

✔ Type **ellipse <Enter>** at the Command prompt.

*There is an **Ellipse** tool on the ribbon, but this automates an initial option and doesn't give you access to the **Isocircle** option.*

AutoCAD prompts:

```
Specify axis endpoint of ellipse or [Arc/Center/Isocircle]:
```

*The option you want is **Isocircle**. Ignore the others for the time being.*

✔ Select **Isocircle** from the command line, or right-click and select **Isocircle** from the shortcut menu.

AutoCAD prompts:

```
Specify center of isocircle:
```

If you could not locate the center point, you would have to exit the command now and start over.

✔ Use the **Snap Mode** and **Grid Mode** tools to specify the center of the ellipse, as shown in Figure 11-12. If you have drawn your object with the suggested dimensions, the center point will be over 2 units and back 2 units from the top-front corner of the bracket.

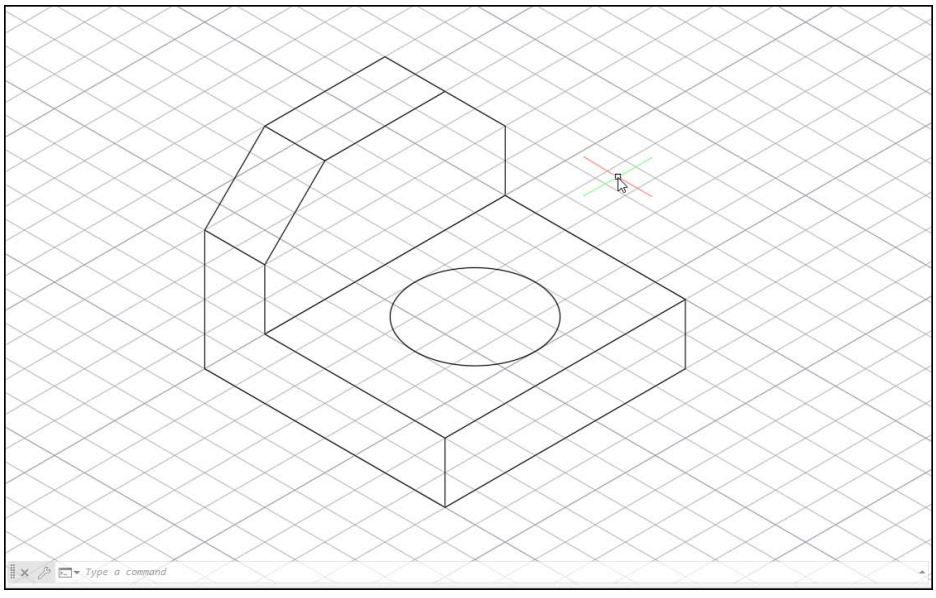


Figure 11-12
Ellipse isocircle

*AutoCAD presents you with an isocircle to drag, as in the **CIRCLE** command. The isocircle you see depends on the isoplane you're in. To understand this, try switching planes to see how the preview changes.*

✔ Drag the cursor to define the radius of the isocircle and then press **<F5>** to switch isoplanes. Observe the isocircle. Try this two or three times.

✔ Switch to the top isoplane before moving on.

AutoCAD prompts for a radius or diameter:

```
Specify radius of isocircle or [Diameter]:
```

*A radius specification is the default here, as it is in the **CIRCLE** command.*

✔ Specify a point so that your isocircle resembles the one in Figure 11-12.

*Next, you use the **COPY** and **TRIM** commands to create the bottom of the hole.*

✔ Start the **COPY** command.

✔ Select the isocircle.

✔ Right-click to end object selection.

✔ Specify the top-front corner of the bracket.

Any point can be used as the base point. By specifying the top-front corner, the bottom-front corner gives you the exact thickness of the bracket.

✔ Specify the bottom-front corner. Make sure you are in an isoplane that allows movement from top to bottom (the left or right isoplanes).

Your drawing should now resemble Figure 11-13. The last thing you must do is trim the hidden portion of the bottom of the hole.

✔ Press **<Enter>** to exit **COPY**.

✔ Start the **TRIM** command.

✔ Select **cuTting edges** from the command line, or right-click and select **cuTting edges** from the shortcut menu.

✔ Select the first isocircle as a cutting edge.

It may help to turn off snap to make these selections.

✔ Right-click to end cutting edge selection.

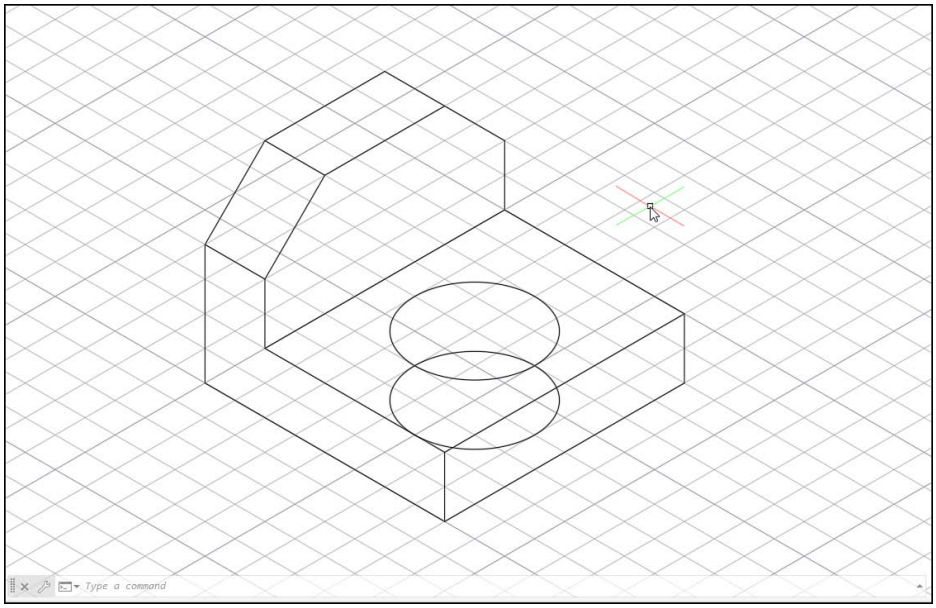


Figure 11-13
Copy isocircle

- ✔ Select the hidden section of the lower isocircle.
- ✔ Press **<Enter>** to exit **TRIM**.

  The bracket is now complete, and your drawing should resemble Figure 11-14.

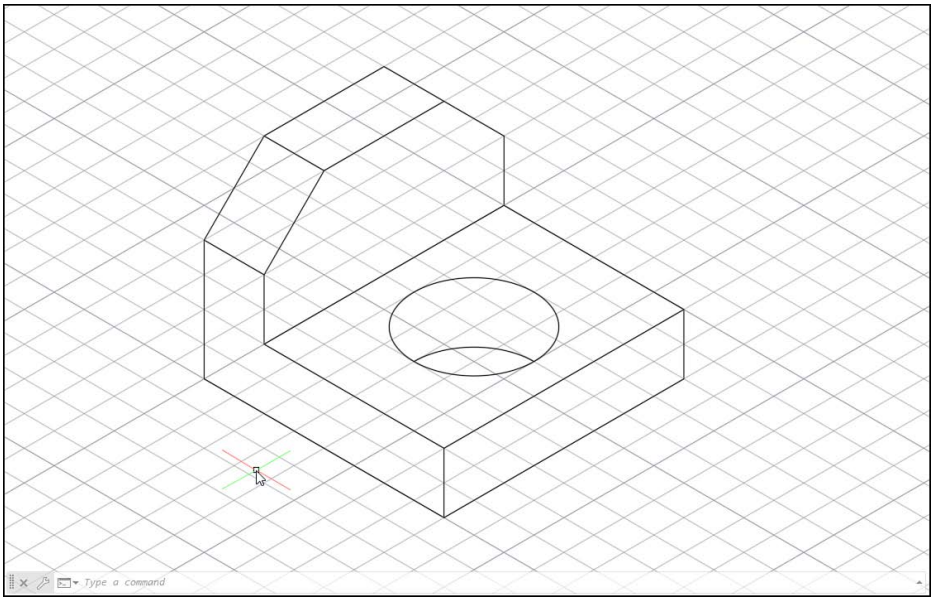


Figure 11-14
Trimming lower isocircle

Drawing Text Aligned with Isometric Planes

Adding text to isometric drawings has some challenges you may not have encountered previously. To create the appearance that text aligns with an isometric plane, it needs to be altered in two ways. First, the whole line of text needs to be rotated to align with one side of the plane. Second, the obliquing angle of individual characters needs to be adjusted to match the plane's tilt. Rotation angle, you recall, is handled through the command sequence of the **TEXT** command. Obliquing angle is set as a text style characteristic using the **STYLE** command.

Typically, text in an isometric drawing aligns with one of the three isometric planes. In order to demonstrate how this works, you add a single-line text object to each of the planes of the bracket, as shown in Figure 11-15. Though you will be drawing on three planes, you can accomplish this with only two new text styles. These will be simple variations of the Standard text style, with the oblique angles needed for isometric alignment. The right isoplane will use a 30° oblique angle, while the top and left planes will use a –30° angle.

- ✔ To begin, you should be in the bracket drawing created in the previous sections. Isometric snap and grid modes should be enabled.
- ✔ Click the **Home** tab, expand the **Annotation** panel, and then click the **Text Style** tool in the top left, next to the name of the current text style (**Standard**).

  *This opens the **Text Style** dialog box. The first new text style you create will be used for drawing text on the right isoplane. If you look*

at Figure 11-15, you can see that this text (the word Right) is rotated along the 30° X-axis of the isoplane. What may be less obvious is that the individual characters are also drawn at a 30° oblique angle. You enter the rotation angle when creating the text. Here, you set the oblique angle for this plane.

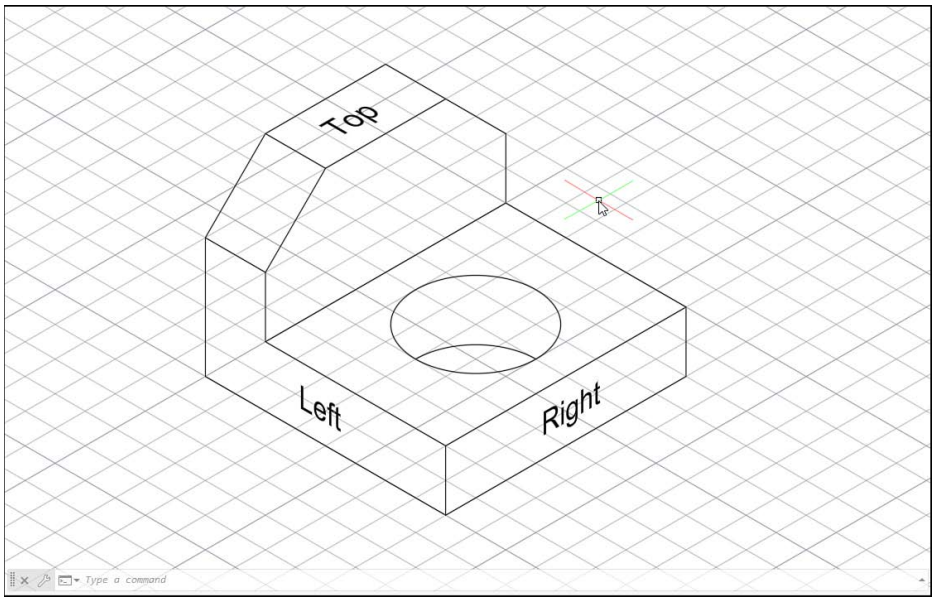


Figure 11-15
Drawing text in isometric view

- ✔ In the **Text Style** dialog box, click the **New** button.
- ✔ In the **New Text Style** dialog box, type **Isotext30**.
- ✔ Click **OK**.
- ✔ Change the **Oblique Angle** to **30**.
- ✔ Click **Apply**.
  You repeat these steps to create a style with –30° obliquing angle.
- ✔ Click the **New** button.
- ✔ In the **New Text Style** dialog box, type **isotext-30**.
- ✔ Click **OK**.
- ✔ Change the **Oblique Angle** to **–30**.
- ✔ Click **Apply**.
- ✔ Highlight **isotext30** in the **Styles** list.
- ✔ If you see a message saying the current text style has been modified, click **Yes**.
  *You should now be back in the drawing with **isotext30** as the current text style. You are now ready to add the single-line text.*
- ✔ Click the **Set Current** button.
- ✔ Click **Close**.
- ✔ Make sure to be on the right isoplane. Press **<F5>** to cycle through the isoplanes until you get to the right isoplane.

- ✔ On the **Annotation** panel, click the **Multiline Text/Single-line** text drop-down menu and choose the **Single Line** text tool.
- ✔ Use the **Justify** option and set the justification for the new text to **Middle Center (MC)**.
- ✔ Specify the middle point on the right front of the bracket, as shown by the placement of the word *Right* in Figure 11-15.
- ✔ Specify a text height of **.30**.
- ✔ Type **30 <Enter>** for the rotation angle.
- ✔ Type **Right <Enter>**.
- ✔ Press **<Enter>**.

  *The word Right should be drawn on the bracket, as shown in Figure 11-15. Now draw the word Left on the left isoplane, as shown. This will use the **isotext-30** style and a rotation angle of –30°.*
- ✔ Expand the **Annotation** panel and select **isotext-30** from the **Text Style** drop-down list.
- ✔ Press **<F5>** to set the left isoplane current.
- ✔ Click the **Single Line** text tool from the **Annotation** panel.
- ✔ Specify the middle point on the left side of the bracket, as shown by the placement of the word *Left* in Figure 11-15.
- ✔ Specify a text height of **.30**.
- ✔ Type **–30 <Enter>** for the rotation angle.
- ✔ Type **Left <Enter>**.
- ✔ Press **<Enter>**.

Finally, for text in the top isoplane, use **isotext-30** with a rotation angle of +30°.

- ✔ Press **<F5>** to set the top isoplane current.
- ✔ Click the **Single Line** text tool from the **Annotation** panel.
- ✔ Specify the middle point on the top of the bracket, as shown by the placement of the word *Top* in Figure 11-15.
- ✔ Press **<Enter>** for a text height of **.30**.
- ✔ Type **30 <Enter>** for the rotation angle.
- ✔ Type **Top <Enter>**.
- ✔ Press **<Enter>**.

  Your drawing should resemble Figure 11-15.

This completes the present discussion of isometric drawing. You can find more in the drawing suggestions at the end of this chapter.

Next, you go on to exploring the nonisometric use of the **ELLIPSE** command and saving named views with the **VIEW** command.

Drawing Ellipses in Orthographic Views

orthographic view: One of six standard views in which the observer's point of view is normal to the front, back, left, right, top, or bottom of the drawing plane.

The **ELLIPSE** command is important not only for drawing isocircles but also for drawing true ellipses in ***orthographic views***. There is also an option to create elliptical arcs.


An ellipse is determined by a center point and two perpendicular axes of differing lengths. In AutoCAD, these specifications can be shown in two nearly identical ways, each requiring you to show three points (see Figure 11-16). In the default method, you show two endpoints of an axis and then show half the length of the other axis, from the midpoint of the first axis out. (The midpoint of an axis is also the center of the ellipse.) The other method allows you to specify the center point of the ellipse first, then the endpoint of one axis, followed by half the length of the other axis.

✔ In preparation for this exercise, return to the standard **Snap** mode and **Grid** mode by clicking the **ISODRAFT** tool on the status bar to turn off the **Isometric Snap** mode.

Your grid is returned to the standard pattern of lines, and the crosshairs are horizontal and vertical again. Notice that this does not affect the isometric bracket you have just drawn.

*You briefly explore the **ELLIPSE** command and draw some standard ellipses.*

Figure 11-16
Ellipse axis and center

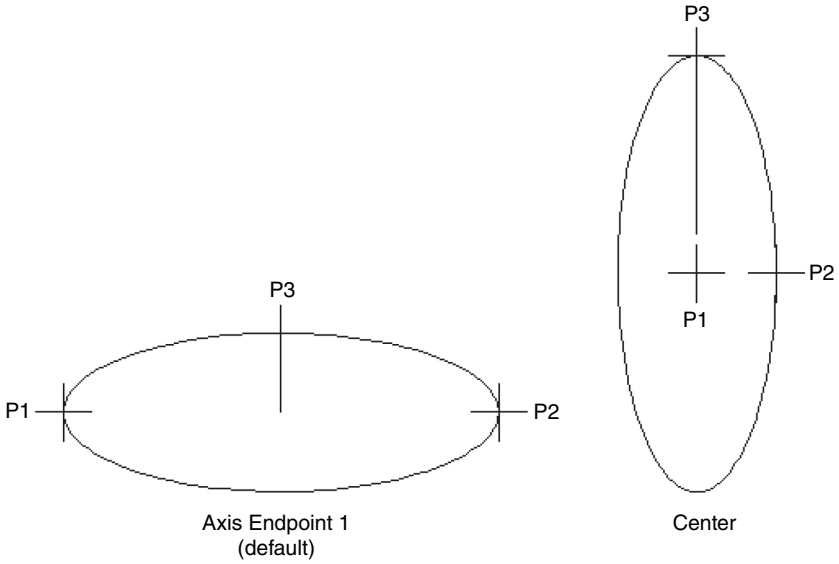

✔ **Ortho** should be off for this exercise.

✔ On the **Home** tab, click the **Ellipse** drop-down menu on the **Draw** panel and then select the **Axis**, **End** tool, as shown in Figure 11-17.

AutoCAD prompts:

```
Specify axis endpoint of ellipse or [Arc/Center]:
```

✔ Specify the axis endpoint, as shown by P1 on the ellipse at the lower left in Figure 11-18.

AutoCAD prompts for the other endpoint:

```
Specify other endpoint of axis:
```

✔ Specify the second endpoint, as shown by P2.

As you drag the rubber band, a preview of the ellipse is updated to show the length of the other axis. Only the length of the rubber band is significant; the angle is already determined to be perpendicular to the first axis. Because of this, the third point falls on the ellipse only if the rubber band happens to be exactly perpendicular to the first axis.

Figure 11-17
Ellipse Axis, End tool


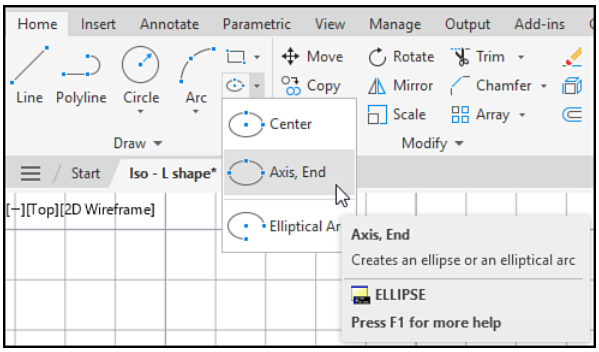


Figure 11-18
Drawing standard ellipses

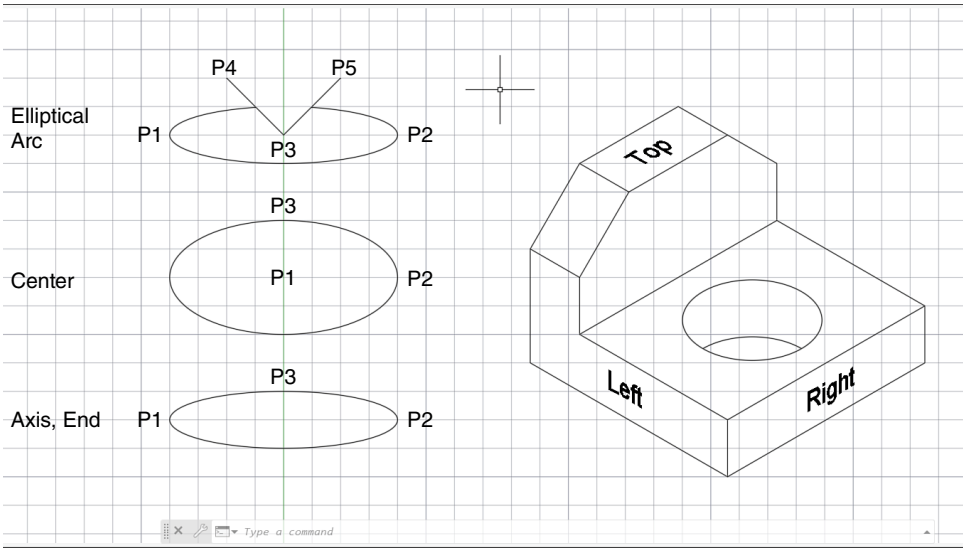

As before, the following prompt allows you to specify the second axis distance or a rotation around the first axis:

```
Specify distance to other axis or [Rotation]:
```

*The **Rotation** option is awkward to use and is not explored here; see the AutoCAD Command Reference for more information.*

✔ Specify P3 as shown.

This point shows half the length of the other axis.

The first ellipse should now be complete. Next, you draw one by specifying the center point first, using the **Center** ellipse tool from the ribbon.

✔ Click the **Center** tool from the **Ellipse** drop-down menu on the ribbon's **Draw** panel.

*This uses the **Center** option.*

AutoCAD prompts you for a center point:

```
Specify center of ellipse:
```

✔ Specify the center point, as shown by P1 at the middle left in Figure 11-18.

Now, you have a rubber band stretching from the center to the end of an axis and the following prompt:

```
Specify endpoint of axis:
```

✔ Specify an endpoint, as shown by P2 in Figure 11-18.

The prompt that follows allows you to specify the second axis distance as before, or a rotation around the first axis:

```
Specify distance to other axis or [Rotation]:
```

✔ Specify an axis distance, as shown by P3.

Here again, the rubber band is significant for distance only. The point you specify falls on the ellipse only if the rubber band is stretched perpendicular to the first axis. Notice that it isn't so in Figure 11-18.

Drawing Elliptical Arcs

Elliptical arcs can be drawn by trimming complete ellipses or using the **ELLIPSE** command's **Arc** option. Using the **Arc** option, you first construct an ellipse using one of the two methods shown previously and then define the arc of the ellipse that you want to keep.

✔ Click the **Elliptical Arc** tool from the **Ellipse** drop-down menu on the ribbon's **Draw** panel.

✔ Specify the first axis endpoint, as shown by P1 at the upper left in Figure 11-18.

✔ Specify the second endpoint, P2 in the figure.

✔ Specify P3 to indicate the second axis distance.

*AutoCAD draws an ellipse as you have specified, but the object is only temporary. Now, you need to show the arc you want drawn. The two options are **Parameter** and **Included angle**. **Parameter** takes you into more options that allow you to specify your arc in different ways, similar to the options of the **ARC** command. Stick with the default option here.*

✔ Specify P4 to indicate the angle at which the elliptical arc begins.

Move the cursor slowly along the ellipse's preview, and you can see all the arcs that are possible, starting from this angle.

✔ Specify P5 to indicate the end angle and complete the ellipse.

Saving and Restoring Displays with VIEW

VIEW	
Command	VIEW
Alias	V
Panel	Views
Tool	

The word *view* in connection with the **VIEW** command has a special significance in a drawing. It refers to any set of display boundaries that have been named and saved using the **VIEW** command. It also refers to a defined 3D viewpoint that has been saved with a name. Saved views can be restored by direct reference rather than by redefining the location, size, or viewpoint of the area to be displayed. **VIEW** can be useful in creating drawing layouts and when you know you will be returning frequently to a certain area of a large drawing. It saves you from having to zoom out to look at the complete drawing and then zoom in again on the area you want. It can also save time in creating a 3D viewpoint. In this chapter, you learn to use 2D views only.

Imagine that you have to complete some detail work on the area around the hole in the bracket and also on the top corner. You can define each of these as a view and jump back and forth at will.

- ✔ To begin this exercise, you should have the bracket in your drawing, as shown in Figure 11-19.
- ✔ Type **view <Enter>** or click **View > Named Views > View Manager** from the ribbon, as shown in Figure 11-20.

  *This displays the **View Manager** dialog box shown in Figure 11-21. At the left is a list of views, including **Current**, **Model Views**, **Layout Views**, and **Preset Views**. In this chapter, you only work with the **Current** view, which you define and name.*

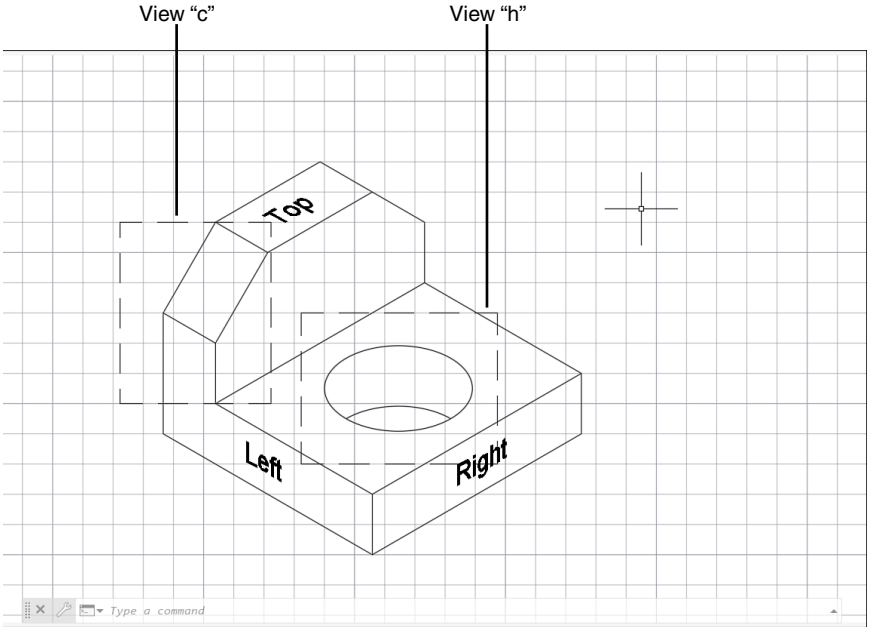


Figure 11-19
Defining views

Figure 11-20
View Manager tool


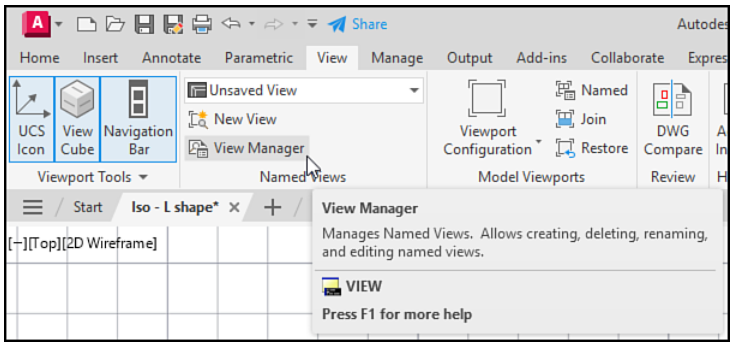


Figure 11-21
View Manager dialog box

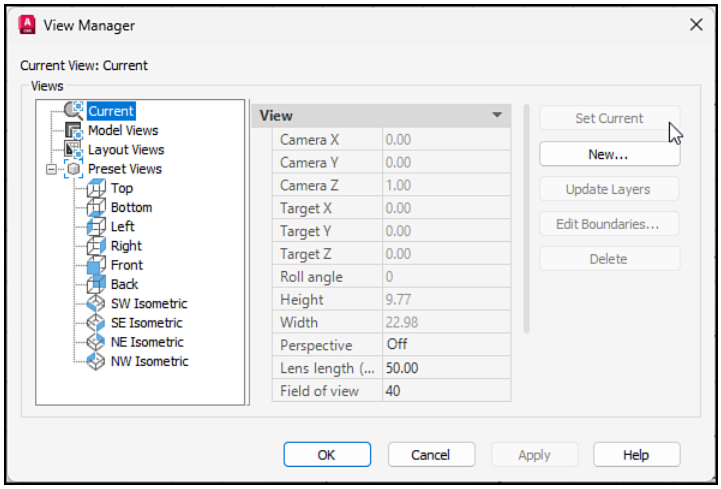

✔ Click the **New** button.
*This takes you to the **New View/Shot Properties** dialog box shown in Figure 11-22. Notice that the **Current Display** option is selected in the **Boundary** panel. All you have to do is give the current display a name to save it as a named view.*

✔ Type **Bracket** in the **View Name** edit box.


✔ Click **OK**.
*The **View Manager** dialog box reappears, with **Bracket** now showing under the **Model Views** heading. All views defined in model space will be listed as **Model Views**. Views defined in paper space will be listed as **Layout Views**. Next, you use a window to define a model space with a smaller area as a view.*

✔ Click the **New** button to return to the **New View/Shot Properties** dialog box.

✔ Type **Hole** in the **View Name** edit box.
This view zooms in on the hole.

✔ Select the **Define Window** option in the **Boundary** panel.
The dialog box closes, giving you access to the drawing area where the current view is outlined. The rest of the drawing is grayed out.

Figure 11-22
New View/Shot Properties dialog box

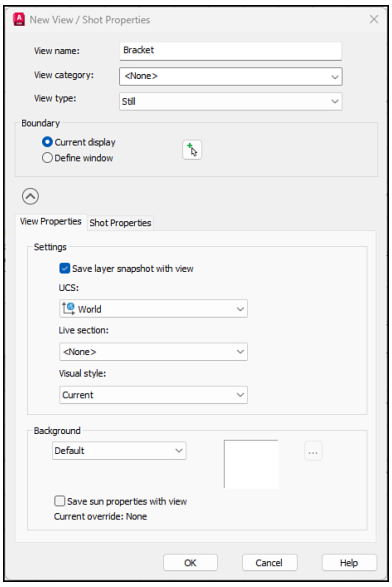

- ✔ Specify the first and second corners to define a window around the hole in the bracket, as shown previously in Figure 11-19.
  A window outline of the new view is shown, with the rest of the drawing grayed out.
- ✔ Press **<Enter>** to return to the **New View/Shot Properties** dialog box.
- ✔ Click **OK** to save the named view.
  *You are now back in the **View Manager** dialog box with **Bracket** and **Hole** in the list of **Model Views**. Define one more view to show the upper-left corner of the bracket, as shown in Figure 11-19.*
- ✔ Click the **New** button.
- ✔ Type **Corner** for the view name.
- ✔ Select the **Define Window** option.
- ✔ Define a window, as shown in Figure 11-19.
- ✔ Press **<Enter>** to return to the dialog box.
- ✔ Click **OK** to close the **New View/Shot Properties** dialog box.
  *You have now defined three model views. To see the views in action, you must set them as current. Notice that the new view names are now displayed in a list on the **Views** panel, as shown in Figure 11-23.*
- ✔ Double-click **Hole** in the **Views** list.
- ✔ *Click* **OK**.
  Your drawing should resemble Figure 11-24.
  Now, switch to the corner view.
- ✔ Instead of using the **View Manager** again to set a view current, click the **Views** drop-down list on the ribbon's **Named Views** panel.
- ✔ Select **Corner** from the **Views** list.
  Your drawing should resemble Figure 11-25.

Figure 11-23
New view list on the **Views** panel

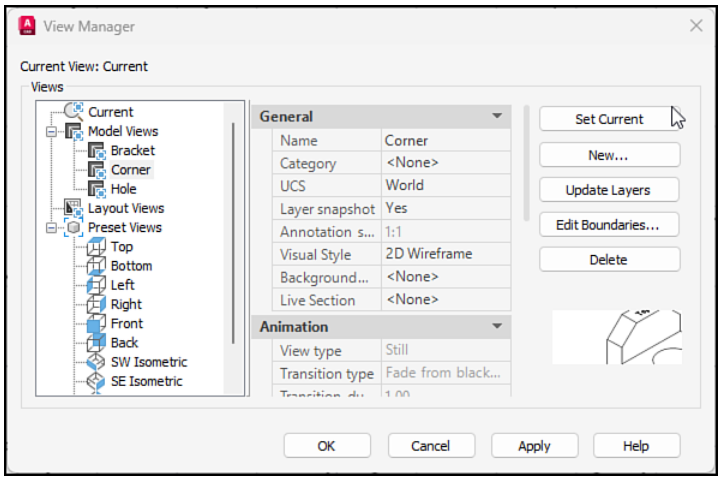


Figure 11-24
Hole view


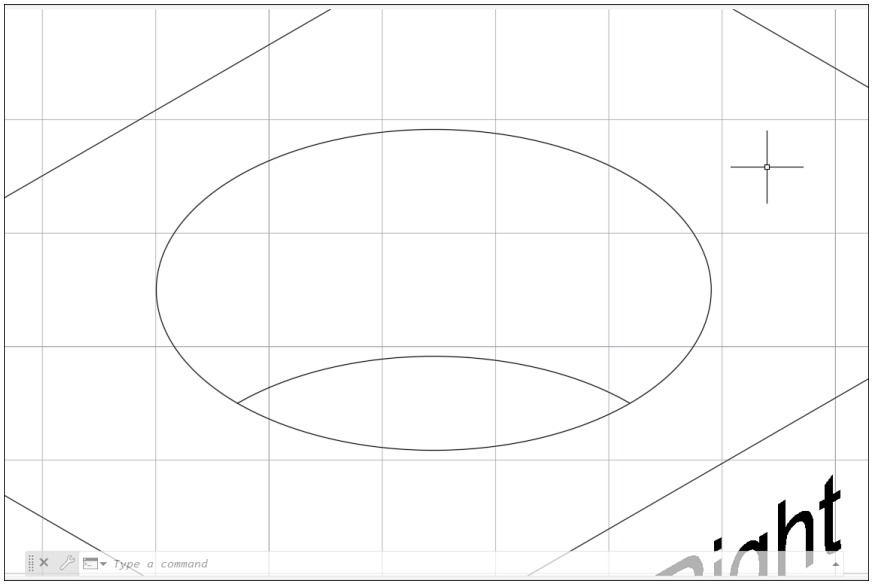


Figure 11-25
Corner view

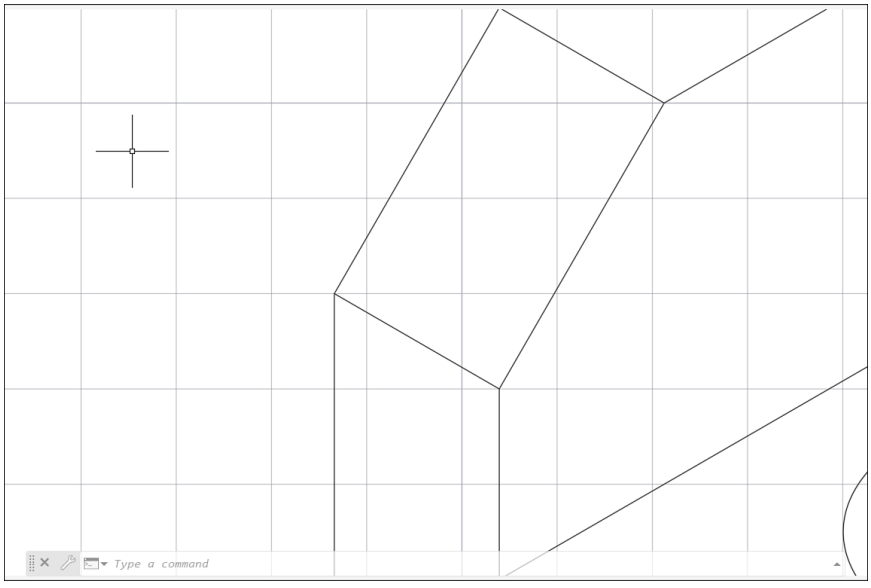

chapter eleven

Chapter Summary

In this chapter, you were introduced to using the grid display and **Snap** mode to facilitate drawing geometry other than the standard orthographic 2D representation. You learned the use of the isometric grid to create an isometric drawing. In this mode, grid lines were shown at 30°, 90°, and 150° angles, and the crosshairs were oriented to the top, left, and right isoplanes. You used the **<F5>** key to switch among these planes, and the **LINE**, **COPY**, and **TRIM** commands to draw simple objects in isometric orientation. You also drew single-line text aligned with each of the three isoplanes. You also learned the use of the **ELLIPSE** command to create ellipses that appear as circles in isometric planes and also drew ellipses in standard orthographic views. Finally, you were introduced to the **VIEW** command, which allows you to define any display as a named view that can be restored at any time.

Chapter Test Questions

Multiple Choice

Circle the correct answer.

1. Change to this to align the grid with isometric planes:

a. Change grid to polar

b. Change grid to isometric

c. Change grid to 2D model space

d. Change snap to 2D model space

2. Which of these does **not** name an isoplane in AutoCAD?

a. Right

b. Left

c. Front

d. Top

3. The command used to draw circles in isometric views is

a. **ISOCIRCLE**

b. **ELLIPSE**

c. **ISOPLANE**

d. **CIRCLE**

4. To align text with isometric planes, make changes to

a. Rotation and oblique angles

b. Text style and alignment

c. Alignment style and rotation

d. Rotation angle and grid style

5. The minimum number of points required to define an elliptical arc are

a. 2

b. 3

c. 4

d. 5

Matching

Write the number of the correct answer on the line.

a. Isoplane switch _____
b. Isocircle _____
c. Right isoplane text _____
d. Top isoplane text _____
e. Default view _____

1. Ellipse
2. 30°, 30°
3. 30°, –30°
4. **<F5>**
5. Current display

True or False

Circle the correct answer.

1. **True or False:** Isometric drawings are two-dimensional.
2. **True or False:** Isometric drawings show no true distances.
3. **True or False:** To draw an isometric circle, it's necessary to specify a center point.
4. **True or False:** To switch isoplanes, you must open the **Drafting Settings** dialog box.
5. **True or False:** Drawing isocircles is the same as drawing ellipses in orthographic views.

Questions

1. What are the angles of the crosshairs and grid lines in an isometric grid?
2. What are the names for the isometric planes in AutoCAD?
3. What is an isocircle? Why are isocircles drawn with the **ELLIPSE** command?
4. How many different isocircles can you draw with the same radius and the same center point?
5. What rotation angle and oblique angle are used to align text with each of the three isoplanes?

Drawing Problems

1. Using the isometric grid, draw a 4 × 4 square in the right isoplane.
2. Copy the square back 4.00 units along the left isoplane.
3. Connect the corners of the two squares to form an isometric cube. Erase any lines that would be hidden in this object.

4. Use text rotation and obliquing to draw the word *Top* in the top plane of the cube so that the text is centered on the face and aligned with its edges. The text should be 0.5-unit high.

5. In a similar manner, draw the word *Left* at the center of the left side and the word *Right* at the center of the right side. All text should align with the face on which it is located.

chapter 11 eleven

Chapter Drawing Projects

M


Drawing 11-1: *Isometric Projects* [INTERMEDIATE]

This drawing is a direct extension of the exercises in the chapter. It gives you practice in basic AutoCAD isometrics and in transferring dimensions from orthographic to isometric views.

Drawing Suggestions

- Set your grid to **.50** and your snap to **.25** to create all the objects in this project. Your grid should match the grid of this drawing. Notice that some lines do not fall on grid points but halfway between.
- There is no **Arc** option when you use **ELLIPSE** to draw isocircles, so semicircles such as those at the back of the holes must be constructed by first drawing isocircles and then trimming or erasing unwanted portions.
- To draw the portion of the isocircle that shows the depth of a circle, copy the isocircle down or back, snapping from endpoint to endpoint of other lines in the view that shows the depth.
- Often, when you try to select a group of objects to copy, there are many crossing lines that you do not want to include in the copy. This is an ideal time to use the **Remove** option in object selection. First, window the objects you want along with those nearby that are unavoidable and then remove the unwanted objects one by one.
- Sometimes, you may get unexpected results when you try to trim an object in an isometric view. For example, AutoCAD divides an ellipse into a series of arcs and trims only a portion. If you do not get the results you want, use a **Nearest** object snap to control how the object is trimmed.

Drawing 11-1
Isometric projects

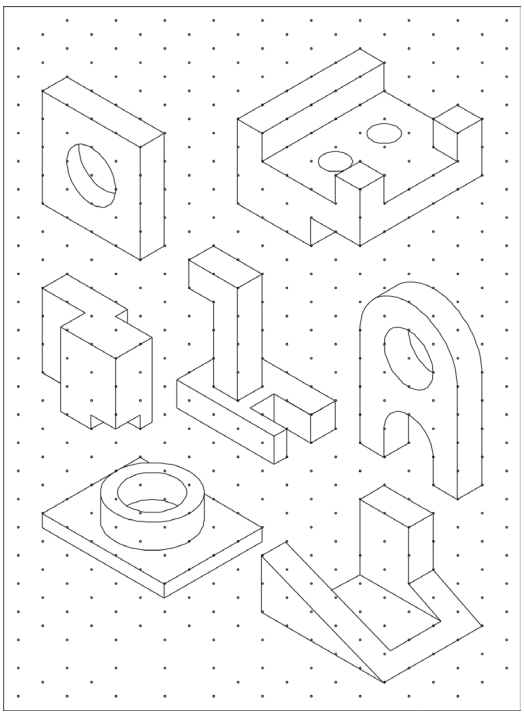


M Drawing 11-2: *MP3 Player* [ADVANCED]

This drawing introduces text and combines a complete set of 2D views with an isometric representation of the object. Placing objects on different layers so they can be turned on and off during **TRIM** and **ERASE** procedures makes things considerably less messy.

Drawing Suggestions

- Use the box method to create the isometric view of this drawing. That is, begin with an isometric box according to the overall outside dimensions of the MP3 player. Then trim and add the details.
- The dial is made from isocircles with copies to show thickness. You can use the **Tangent** object snap to draw the front-to-back connecting lines.
- Use a gradient hatch for the video window area.
- Use the **isotext30** and **isotext-30** text styles created in this chapter for drawing the text on the left and right isoplanes, as shown.

Drawing 11-2
MP3 player

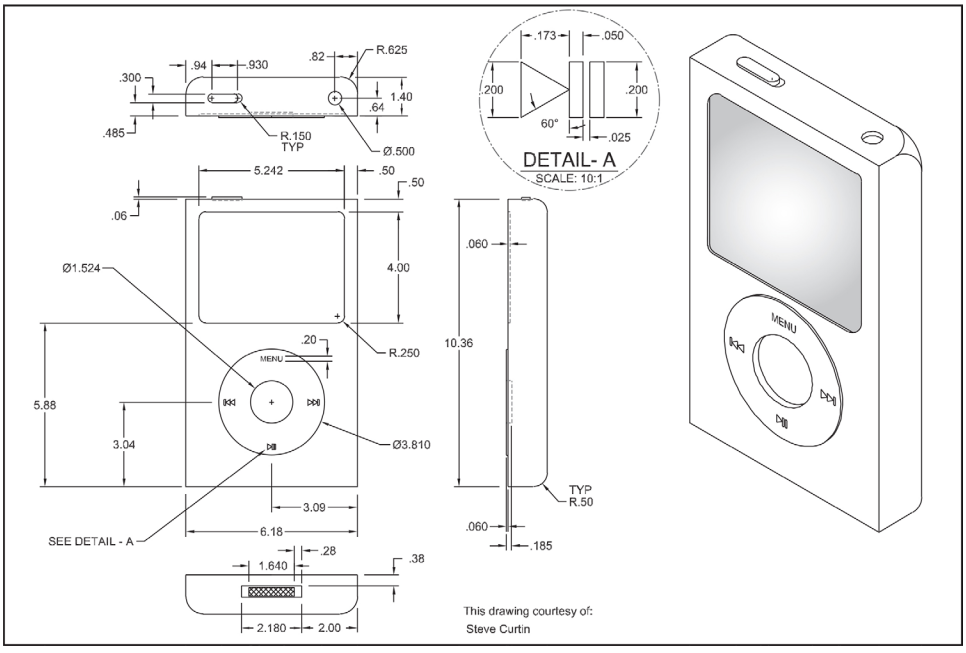


G Drawing 11-3: *Fixture Assembly* [ADVANCED]

This is a difficult drawing. It takes time and patience but teaches you a great deal about isometric drawing in AutoCAD.

Drawing Suggestions


- This drawing can be completed either by drawing everything in place as you see it or by drawing the parts and moving them into place along the common centerline that runs through the middle of all the items. If you use the former method, draw the centerline first and use it to locate the center points of isocircles and as base points for other measures.
- As you go, look for pieces of objects that can be copied from other objects. Avoid duplicating efforts by editing before copying. In particular, when one object covers part of another, be sure to copy it before you trim or erase the covered sections.
- To create the chamfered end of Item 4, begin by drawing the 1.00-diameter cylinder 3.00 long with no chamfer. Then, copy the isocircle at the end forward 0.125. The smaller isocircle is 0.875 (7/8) because 0.0625 (1/16) is cut away from the 1.00 circle all around. Draw this smaller isocircle and trim away everything that is hidden. Then draw the slanted chamfer lines using **LINE**, not **CHAMFER**. Use the same method for Item 5.
- In both the screw and the nut, you need to create hexes around isocircles. Use the dimensions from a standard bolt chart.
- Use three-point arcs to approximate the curves on the screw bolt and the nut. Your goal is a representation that looks correct. It's impractical and unnecessary to achieve exact measures on these objects in the isometric view.

Drawing 11-3
Fixture assembly

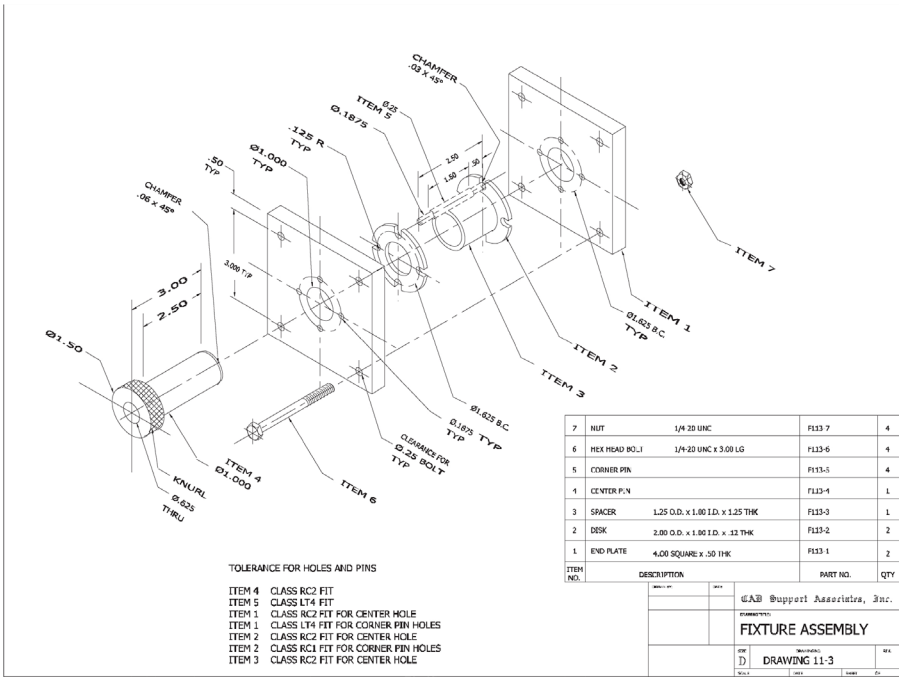

M Drawing 11-4: *Flanged Coupling* [ADVANCED]


The isometric view in this three-view drawing must be completed working off the centerline.

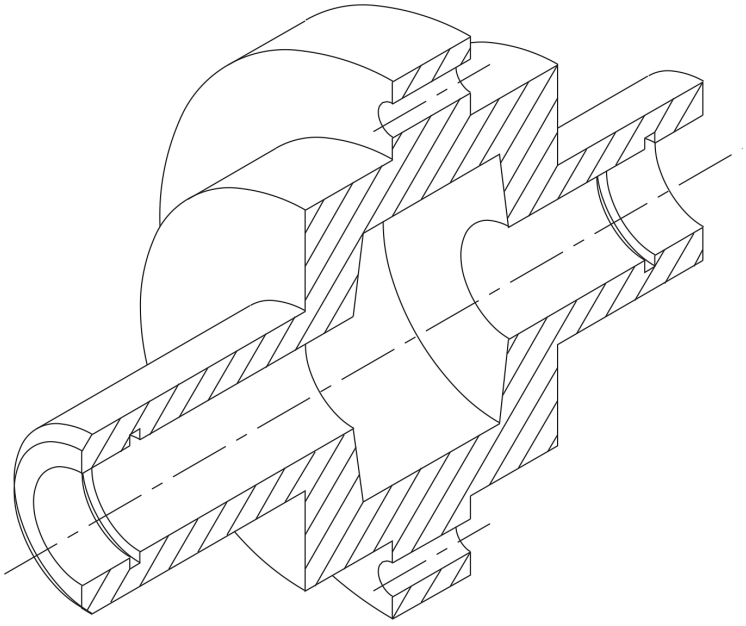

Drawing Suggestions

- Draw the major centerline first. Then draw vertical centerlines at every point where an isocircle is to be drawn. Make sure to draw these lines extra long so they can be used to trim the isocircles in half. By starting at the back of the object and working forward, you can take dimensions directly from the right-side view.
- Draw the isocircles at each centerline and then trim them to represent semicircles.
- Use the **Endpoint**, **Intersection**, and **Tangent** object snaps to draw horizontal lines.
- Trim away all obstructed lines and parts of isocircles.
- Draw the four slanted lines in the middle as vertical lines first. Then, with **Ortho** off, change their endpoints, moving them 0.125 closer.
- Remember, **MIRROR** does not work in the isometric view, although it can be used effectively in the right-side view.
- Use **HATCH** to create the crosshatching.
- If you have made a mistake in measuring along the major centerline, you can use **STRETCH** to correct it. Make sure **Ortho** is on and you are in an isoplane that lets you move the way you want.

Drawing 11-4
Flanged coupling

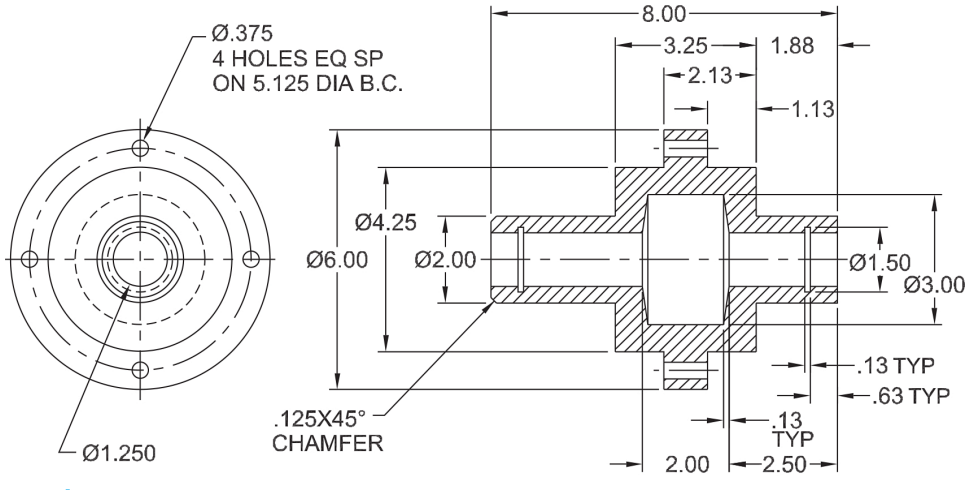

A Drawing 11-5: *Garage Framing* [ADVANCED]

This is a fairly complex drawing that takes lots of trimming and careful work. One method you frequently can use in isometric drawing is changing the **SNAPANG** (snap angle) variable so that you can draw slanted arrays.


Drawing Suggestions

- You will find yourself using **COPY**, **ZOOM**, and **TRIM** a great deal. **OFFSET** also works well.
- You may want to create some new layers with different colors. Keeping different parts of the construction walls, rafters, and joists on different layers allows you to have more control over them and adds a lot of clarity to what you see on the screen. Turning layers on and off can considerably simplify trimming operations.
- You can cut down on repetition in this drawing by using arrays on various angles. For example, if the **SNAPANG** variable is set to 150°, you can create the 229 wall in the left isoplane as a rectangular array of studs with 1 row and 17 columns set 160 apart. To do so, follow this procedure:

  1. Type **snapang and press <Enter>**.
  2. Enter a new value so that rectangular arrays are created at isometric angles (30° or 150°).
  3. Enter the **ARRAY** command and create the array. Use negative values where necessary.
  4. Trim the opening for the window.


- One alternative to this array method is to set your snap to **16"** temporarily and use **COPY** to create the columns of studs, rafters, and joists. Another alternative is to use the grip edit offset snap method beginning with an offset snap of 16" (that is, press **<Shift>** when you show the first copy displacement and continue to hold down **<Shift>** as you make other copies).
- The cutaway in the roof that shows the joists and the back door is drawn using the standard nonisometric **ELLIPSE** command. Then, the rafters are trimmed to the ellipse, and the ellipse is erased. Do this procedure before you draw the joists and the back wall. Otherwise, you will need to trim these as well.
- Use **CHAMFER** to create the chamfered corners on the joists.

Drawing 11-5
Garage framing

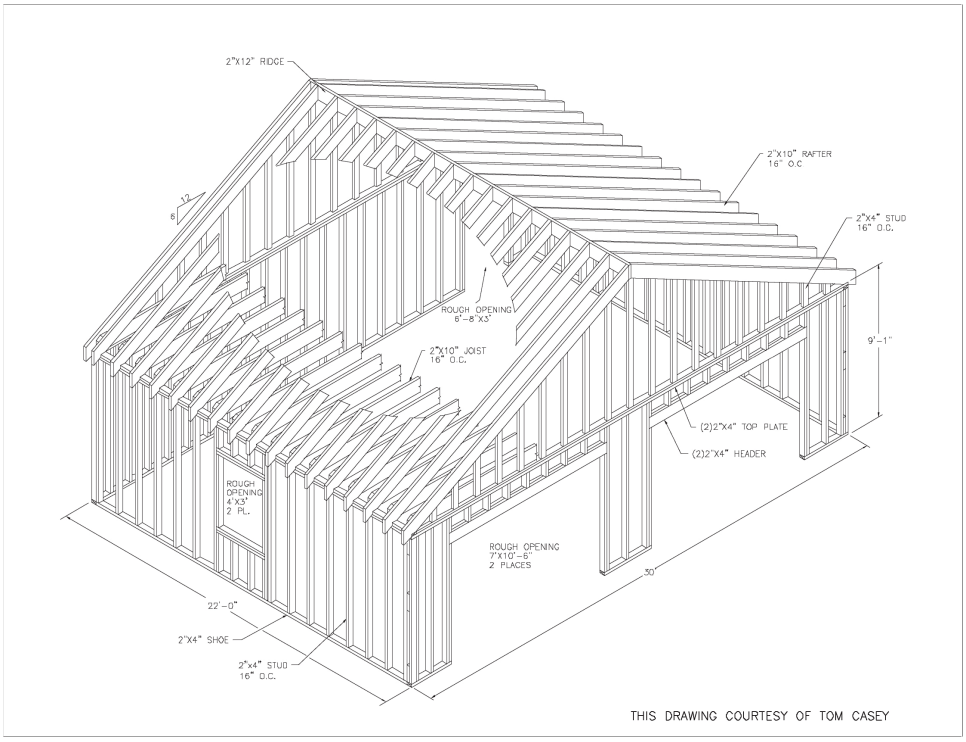

P Drawing 11-6: *Cast Iron Tee* [ADVANCED]


The objective of this exercise is to complete the isometric view of the tee using dimensions from the three-view drawing. Begin this isometric by working off the centerline.

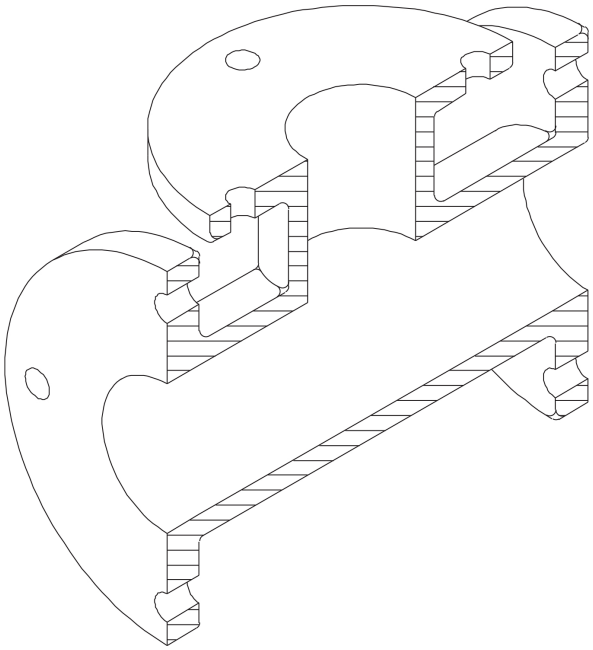

Drawing Suggestions


- Be sure **Ortho** is on and you are in an isoplane that is correct for the lines you want to draw. Take full advantage of object snaps as you complete this drawing.
- First, draw the two major centerlines to exact length, as shown in the isometric view. Then, draw vertical centerlines at every point where an isocircle is to be drawn. These centerlines should be drawn longer so the isocircles can be trimmed more easily. Notice that **OFFSET** and **MIRROR** do not work very well in isometric drafting.
- After establishing the centerlines, draw the isocircles for the three flanges.
- When you have completed the flanges, draw the isocircles for the wall of the tee.
- Draw all horizontal and vertical lines and trim away all nonvisible lines and parts of the isocircles. Fillet the required intersections.
- After completing the outline of the tee, use **HATCH** to create the cross-hatching.

Drawing 11-6
Cast iron tee

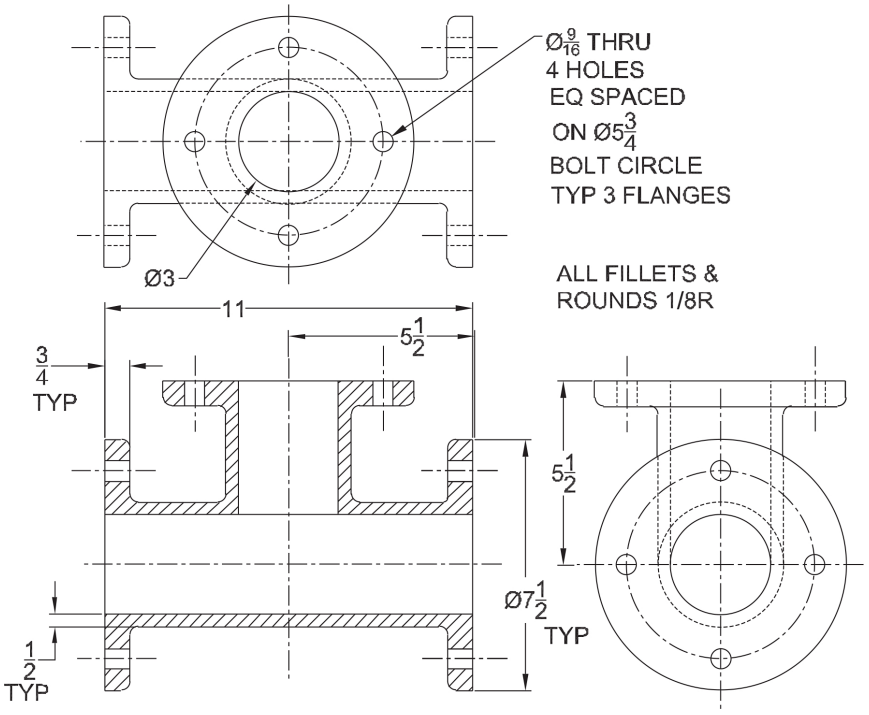

P Drawing 11-7: *Valve* [ADVANCED]


For the purposes of this chapter, the isometric view is most important. The three detail views, the title block, and the border can be included or not, as assigned.

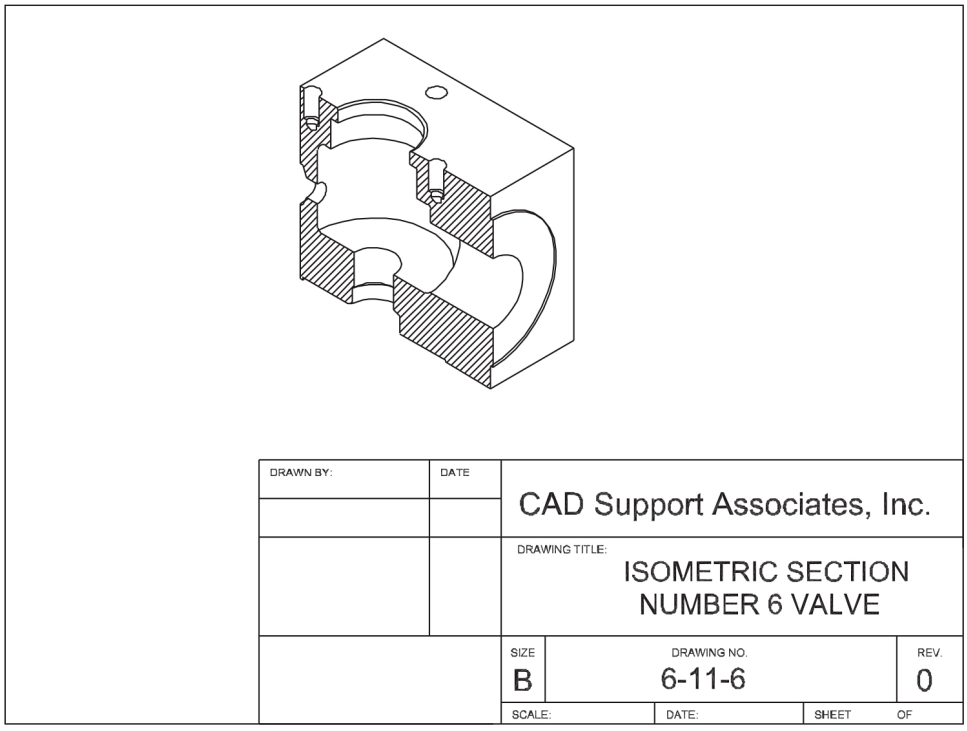

Drawing Suggestions

- Use the box method to create the isometric view in this drawing. Begin with an isometric box according to the overall outside dimensions of the valve. Then go back and cut away the excess so the drawing becomes half the valve, exposing the interior details of the object.
- As in all section drawings, no hidden lines are shown.
- In addition to flat surfaces indicated by hatching, the interior is made up of isocircles of different sizes on different planes.
- Keep all construction lines and centerlines until the drawing is complete. (Draw them on a separate layer, and you can turn off that layer when you no longer need them.)
- The tapped holes are drawn with a series of isocircles that can be arrayed. This is only a representation of a screw thread, so it isn't drawn to precise dimensions. Draw one thread and copy it to the other side.

Drawing 11-7
Valve

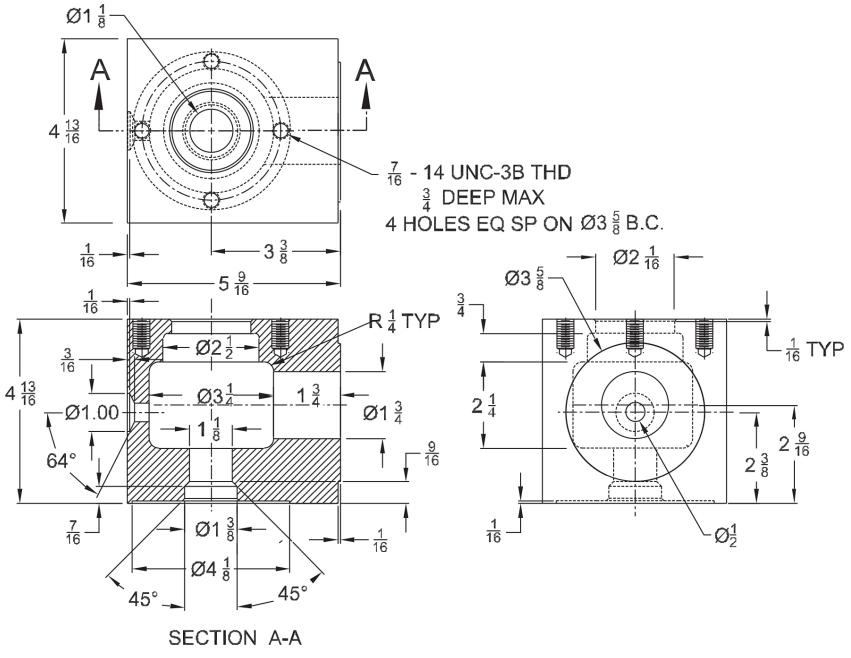

Index

Symbols and Numbers

 # (pound sign), 26–27
@ symbol, relative coordinates, 24
2D outlines, 3D objects from, 665–671
3D Basics workspace, 4, 563, 575–576
3D drawings
coordinates, entering, 567–568
gizmos, 595–597
point filters, 568–569
polysolids, tiled viewports, 632–635
3D landscape walkthrough
3DFLY command, 673–675
3DWALK command, 673–675
animated, 675–679
camera location, 672–673
target location, 672–673
3D modeling
primitives, 577
rendering, 597
background, 604–606
materials, 598–600
presents, 600–604
Render panel, 600–604
views, named, 604–606
solid modeling, 575–576
from 2D drawings, 128–129
Boolean operations, 576–577
chamfers, 590–593
composite solids, 585–591
DUCS (dynamic user coordinate system), 582–585
fillets, 593–594
gizmos, 595–597
lights, 606–613
primitives, 577, 636–638
pyramids, 638–639
sectioning, 641–645
slicing, 640–641
SUBRACT, 585–591
torus, 639–640
UNION, 581–582
visual styles, 580–581
views
details, 618–619
multiple, 615–619
3D Modeling workspace, 4, 79
3DFLY command, 673–675
3DFORBIT command, 658–662
3DORBIT command, 658–664
3DWALK command, 673–675
4 Unit Apartment drawing project, 696
7-Pin Trailer Wiring Diagram drawing project, 168–169

A

absolute coordinates, 8
(pound sign), 26–27
acad.dwt template, 3, 6
ADCENTER command, 487
Add option, 74
Add-a-Plotter Wizard, 162
Add-ins tab, 5
aliases, commands, 13–14
aligned text, 285
Alignment Wheel drawing project, 216–217, 691
Angle Bracket drawing project, 324–325
Angle Support drawing project, 394–395, 693
angled text, 286–287
angles between items, 186

angular dimensions, 347–349
arcs, 349–352
circles, 349–352
animation, 3D walkthrough, 675–679
ANIPATH command, 675–679
Annotate tab, 5
annotation, multileaders, 352–354
Annotation buttons, 6, 299
Annotation Monitor, 5, 6
Annotation panel, 6, 122–123
Annotation tools, 5
Annotative property, 372–373, 454
scale visibility, 374–378
Annotative style text, 296–297
Announcements panel, 4
ANSI standards, 145
Aperture Wheel drawing project, 88–89
Application button, 5
application menu, 5, 16–17
application title bar, 5
application window, 4–5
ARC command, 188–189
3P option, 189–190
options, 190
arcball, 659–662
Archimedes Spiral drawing project, 266–267
arcs, 188–189, 408–410
elliptical, 540
mirror line, 200
Start, Center, Angle tool, 192
Start, Center, End tool, 190–191
three-point option, 189–190
Array Creation contextual tab, 185
ARRAYPOLAR command, 186
ARRAYRECT command, 154–155
contextual tab, 155
multifunctional grips, 156–159
arrays
associativity, 159
contextual tab, 155
polar, 154, 183–184
rows, 185–186
rectangular, 154
associative dimensions, 361–364
associativity, arrays, 159
ATTDEF command, 495–496
ATTDISP command, 500
ATTEDIT command, 500
attributes, 454
blocks, 494–499
definitions, 499–500
inserting blocks with, 499
values, 499–500
data extraction, 503–507
ATTSYNC command, 500
Audodesk Projects panel, 4
AutoCAD, starting, 2
AutoComplete, 13, 14–16
AutoConstrain, 431–434
AutoCorrect, 14–16
Autodesk Account Sign-on, 5
Autodesk App Store, 5
Autodesk Assistant, Help, 66
Auto-hide, 492–493
AutoLISP, 732
AutoPlacement, 464

B

Backgammon Board drawing project, 438–439
BACKGROUND command, 604–606
Base Assembly drawing project, 520–521, 694
BASE command, 460, 484
Base Plate drawing project, 130–131, 690
base point, scaling and, 303
BATTMAN command, 500
BDETECT command, 510
Bill of Materials drawing project, 713, 715
Blend Curves, 115
Block Authoring Palettes, 466
BLOCK command, 457
Block Definition dialog box, 457–458
Block Editor, 464, 465–466
constraints, 472–475
Test Block window, 469–472

Block panel, 6, 457
Block Table data, 475–479
blocks, 453–454
attributes, 494–499
definitions, 499–500
inserting blocks with, 499
values, 499–500
BASE command, 460
Block Editor, 464–465
conversion, automatic, 509
counting, 507–509
creating, 456–460
DBLIST command, 460
detection, automatic, 510
dynamic, 456
constraints, 472–475
creating, 464–469
parameters, 465
EXPLODE command, 460
exploding, 511–512
inserting in drawings, 460–461
with attributes, 499
Blocks palette, 464
Insert tool, 461–464
keyboard blocks, 459
LIST command, 460
Lock position, 496
object snap point, 463
PURGE command, 460
references, external, 500–503
replacing, 509
WBLOCK command, 460
Blocks palette, 464
Boolean operations, 576–577, 653–656
borders, 312
viewports, 378
BOX command, 577–579
BPARAMETER command, 466
BREAK command, 248
BREAKATPOINT command, 248
BREPLACE command, 509
BSEARCH command, 509
Bushing Mount drawing project, 626–627
Button Editor dialog box, 724–725

C

CAD Room drawing project, 516–517
camera location 3D walkthrough, 672–673
Cartesian coordinate system, 8–9
Cast Iron Tee drawing project, 558–559
center marks, 160–161
Center Wheel drawing project, 90–91
centered text, 284
CENTERMARK command, 160–161
CHAMFER command, 101, 112, 115–117, 529, 531–532
Chamfer tool, 115–116
chamfers, 112
alias, 115
isometric drawings, 531–532
solid modeling, 590–593
Trim mode, 114–115
Check Spelling dialog box, 294–295
circles
center marks, 160–161
center point and diameter, 60–63
center point and radius, 58–60
isometric, 532–535
circumscribed *versus* inscribed, 638
Classroom - Floor Plan drawing project, 180–181
Clean Screen button, 6
Cleanscreen on/off, 5
Clipboard, 479–483
Clipboard panel, 6
Clock Face drawing project, 450–451
Close button, 5
Collaborate tab, 5
Color Books color model, 104–105
color models
Color Books, 104–105
True Color, 104–105
colors, layers, 104–106
command entry, 12
command line, 13–14
heads-up design, 12
keyboard, 13–14

Command History, 5
command line, 6
AutoComplete, 13, 14–16
AutoCorrect, 14–16
command entry, 13–14
option selection, 52–53
transparency, 14
command previewing, 28
commands
3DFLY, 673–675
3DFORBIT, 658–662
3DORBIT, 658–664
3DWALK, 673–675
ADCENTER, 487
aliases, 13–14
ANIPATH, 675–679
ARC, 188–189
ARRAYPOLAR, 186
ARRAYRECT, 154–159
ATTDEF, 495–496
ATTDISP, 500
ATTEDIT, 500
ATTSYNC, 500
BACKGROUND, 604–606
BASE, 460, 484
BATTMAN, 500
BDETECT, 510
BLOCK, 457
BOX, 577–579
BPARAMETER, 466
BREAK, 248
BREAKATPOINT, 248
BREPLACE, 509
BSEARCH, 509
CENTERMARK, 160–161
CHAMFER, 101, 112, 115–117, 529, 531–532
CONE, 636–638
COPY, 150–153, 529–530, 533–534
COPYBASE, 479–483
COPYCLIP, 479–483
CUTBASE, 479–483
CUTCLIP, 479–483
DBLIST, 460
DIMALIGNED, 335–339
DIMANGULAR, 335–339
DIMASSOCIATE, 362–364
DIMBASELINE, 342
DIMCONTINUE, 342
DIMEDIT, 336, 359–361
DIMLINEAR, 335–339
DIMORDINATE, 342–347
DIMREASSOCIATE, 362–364
DONUT, 402–404
DSETTINGS, 53–54
EATTEDIT, 500
ELLIPSE, 532–535
ERASE, 28–29, 58, 66
EXPLODE, 460, 511–512
EXTEND, 223, 240–242
EXTRUDE, 665–666
FILL, 404–405
FILLET, 101, 112, 405–408
FIND, 294–295
GROUP, 454–456
HATCH, 364–369
HELIX, 669–670
HELP, 63–66
JOIN, 248
LENGTHEN, 248
LIMITS, 141–142
LINE, 33–34, 228, 529, 530, 722–727
LIST, 460
LTSCALE, 112
MATCHPROP, 300–302
MEASUREGEOM, 223, 248–251
MIRROR, 198–202
MOVE, 146–149
MREDO, 27
MTEXT, 279, 288–289
NEW, 3
new, creating, 721–727
OFFSET, 235–237
OOPS, 67–68
OSNAP, 227
PAN, 101, 118
PASTEBLOCK, 482

PASTECLIP, 482
PEDIT, 405–408, 411–413
PLINE, 400–402, 405–410
PLOT, 33–34
POINT, 421–423
POLYGON, 400–401, 638–639
PRESSPULL, 666–667
PSETUPIN, 206
PURGE, 460, 512–513
QSAVE, 31
QSELECT, 458
RECTANG, 77–79, 116
REDO, 27
REVOLVE, 667–669
ROTATE, 193–196
SAVE, 31–32
SAVEAS, 31–32
SCALE, 304
SLICE, 640–641
SPELL, 294–295
SPLINE, 414–416
SPLINEDIT, 416
STRETCH, 150, 223, 242–248
SWEEP, 670–671
TEXT, 279
TEXTALIGN, 282
TEXTEDIT, 290–291
TRIM, 223, 237–240, 533–534
U, 27–28
UCS, 342–347
Undo, 27–28
UNION, 581–582
VIEW, 541–544
VPCLIP, 379
WBLOCK, 460
WEDGE, 579–580
XOPEN, 494–495
ZOOM, 101, 118–121, 257–260

CONE command, 636–638

constraint bars, 425

constraints, 423–424
AutoConstrain, 431–434
dimensional constraints, 427–429
dynamic blocks, 472–475
geometric constraints, 424–427
Infer Constraints, 431–433
Parameters Manager, 429–431

constructive solid geometry, 576–580

context menus, mouse, 7

Control Panel drawing project, 322–323

Coordinate Display, 5, 8–10
absolute coordinates, 8, 22–23, 26–27
dynamic mode, 20
polar coordinates, 21, 22–23
static mode, 20

coordinate systems
versus viewpoints, 570–574
WCS (world coordinate system), 564

Coordinates, 6

COPY command, 150–151, 152–153, 529–530, 533–534

COPYBASE command, 479–483

COPYCLIP command, 479–483

corners
CHAMFER command, 115–117
fillets, 112–114
Trim mode, 114–115

Count palette, 507–509

crosshairs, 5, 7–9
isometric, 528

crossing lassos, 72–74

crossing windows, selection and, 70–71

CUI (Customize User Interface), 717
editor, 719–720
new commands, 721–727

CUI dialog box, 729–730
legacy elements, 732
LISP files, 732
menu and macro characters, 733
Partial Customization Files, 732
Quick Access toolbars, 730
ribbon, 730
rollover tooltips, 731
shortcut menus, 731
toolbars, 730–731
workspaces, 730

curves, Blend Curves tool, 115

Customization, 5, 6
Customization menu, 8–10
Customize button, 5
CUTBASE command, 479–483
CUTCLIP command, 479–483

D

Dartboard drawing project, 440–441
data extraction, 503–507
DBLIST command, 460
decimal units, 57
Deck Framing drawing project, 274–275
Design #1 drawing project, 40–41
DesignCenter, 454, 487–493
Auto-hide, 492–493
Open Drawings tab, 488
palette creation, 510
Dialog launcher, 5
Dials drawing project, 214–215
diameter
circle drawing, 60–63
dimensions, 350–351
radius, 352
Diluter drawing project, 699
DIMALIGNED command, 335–339
DIMANGULAR command, 335–339
DIMASSOCIATE command, 362–364
DIMBASELINE command, 342
DIMCONTINUE command, 342
DIMEDIT command, 336, 359–361
Dimension Style Manager, 331
dimensional constraints, 427–429
dimensions
angular, 347–349
arcs, 349–352
circles, 349–352
annotation, scale visibility, 374–378
associative, 361–364
diameter, 350–351
hatching, 364–366
gradient fill, 368–369
patterns, 367–368
layers, 102
linear, 334–339
QDIM and, 339–342
ordinate, 342–347
DIMORDINATE command, 342–347
UCS command, 342–347
scaling
model space and, 369–372
paper space and, 369–372
styles, 329–334
Styles list, 331
text, DIMEDIT command, 359–361
viewports, borders, 378
Dimensions panel, 330–331, 335–336
DIMLINEAR command, 335–339
DIMORDINATE command, 342–347
DIMREASSOCIATE command, 362–364
direct distance entry, 24–26
displacements, 150
documents, 2. *See also* drawings
DONUT command, 402–404
Double Bearing Assembly drawing project, 522, 693
double-click actions, 731–732
Drafting & Annotation workspace, 4, 36, 79, 563
Annotation Monitor, 5
Annotation tools, 5
Application button, 5
Autodesk Account Sign-on, 5
Autodesk App Store, 5
Cleanscreen, 5
Close button, 5
Command History, 5
Coordinate Display, 5
crosshairs, 5
Customization, 5
Customize button, 5
Dialog launcher, 5
Drawing area, 5
Drawing file tab, 5
Dynamic, 5
Grid, 5
Help, 5

InfoCenter, 5
Isolate Objects, 5
Isometric Drafting, 5
layout tabs, 5
Maximize button, 5
Minimize button, 5
Model Space, 5
Navigation bar, 5
Navigation wheels, 5
New Drawing, 5
New Layout, 5
Object Snap, 5
Orbit, 5
Ortho on/off, 5
Pan, 5
Polar Tracking, 5
Quick Access toolbar, 5
Ribbon, 5
Ribbon panel, 5
Ribbon tabs, 5
Search, 5
ShowMotion, 5
Snap, 5
Status bar, 5
Stay Connected, 5
Tracking, 5
USC icon, 5
View control, 5
ViewCube, 5
Viewport controls, 5
Visual Style control, 5
Workspace Switching, 5
Zoom, 5
Drafting Settings dialog box, 53–55
Draw panel, 5
Drawing area, 5
Drawing file tab, 5, 6
Drawing orientation panel, 203
drawing projects
1-1: Guide, 38–39
1-2: Design #1, 40–41
1-3: Shim, 42–43
1-4: Stamp, 44–45
1-5: Tiles, 46–47
1-6: Multi Wrench, 48–49
2-1: Aperture Wheel, 88–89
2-2: Center Wheel, 90–91
2-3: Fan Bezel, 92–93
2-5: Gasket, 96–97
2-6: Sheet Metal Stamping, 98–99
3-1: Mounting Plate, 126–127
3-2: Stepped Shaft, 128
3-3: Base Plate, 130–131
3-4: Template, 132–133
3-5: Half Block, 134–135
3-6: Packing Flange, 136–137
4 Unit Apartment, 696
4-1: 7-Pin Trailer Wiring Diagram, 168–169
4-2: Grill, 170–171
4-3: Weave, 172–173
4-4: Test Bracket, 174–175
4-5: Floor Framing, 176–177
4-6: Wall Framing, 178–179
4-7: Classroom - Floor Plan, 180–181
5-1: Hearth, 210–211
5-2: Flanged Bushing, 212–213
5-3: Dials, 214–215
5-4: Alignment Wheel, 216–217
5-5: Index Guide, 220–221
5-5: Mallet, 218–219
6-1: Sprocket, 264–265
6-2: Archimedes Spiral, 266–267
6-3: Link Design, 268–269
6-4: Grooved Hub, 270–271
6-5: Slotted Flange, 272–273
6-6: Deck Framing, 274–275
6-7: Tool Block, 276–277
7-1: Title Block, 316–317
7-2: Gauges, 318–319
7-3: Stamping, 320–321
7-4: Control Panel, 322–323
7-5: Angle Bracket, 324–325
7-6: Koch Snowflake, 326–327
8-1: Tool Block, 382–383
8-2: Flanged Wheel, 384–385
8-3: Knob, 386–387
8-4: Nose Adapter, 388–389

8-5: Plot Plan, 390–391
8-6: Panel, 392–393
8-7: Angle Support, 394–395
8-8: Mirror Mounting Plate, 396–397
9-1: Backgammon Board, 438–439
9-2: Dartboard, 440–441
9-3: Printed Circuit Board, 442–443
9-4: Race Car, 444–445
9-5: Gazebo, 446–447
9-6: Office Building, 448–449
9-7: Clock Face, 450–451
10-1: CAD Room, 516–517
10-2: Office Plan, 518–519
10-3: Base Assembly, 520–521
10-4: Double Bearing Assembly, 522
10-5: Scooter Assembly, 523
11-1: Isometric Projects, 548–549
11-2: MP3 player, 550–551
11-3: Fixture Assembly, 552–553
11-4: Flanged Coupling, 554–555
11-5: Garage Framing, 556–557
11-6: Cast Iron Tee, 558–559
11-7: Valve, 560–561
12-1: Flange, 622–623
12-2: Link Mount, 624–625
12-3: Bushing Mount, 626–627
12-4: Picnic Table, 628–629
13-1: Revolve Designs, 682–683
13-2: Tapered Bushing, 684–685
13-3: Globe, 686–687
13-4: Pivot Mount, 688–689
13-5a: flanged bushing, stepped shaft, and base plate, 690
13-5b: test bracket and packing flange, 691
13-5c: alignment wheel and grooved hub, 691
13-5d: slotted flange and tool block, 692
13-5e: flanged wheel and nose adapter, 692
13-5f: angle support and mirror mounting plate, 693
13-5g: double bearing, 693
13-5h: base assembly, 694
Bill of Materials, 713, 715
Diluter, 699
First Floor Plan, 706
Fluid Sampler Schematic, 698
Front Elevation, 708
Jack Plane, 700–704
Mounting Plate, 714
Outer Conductor, 716
Passenger Locomotive, 712
Pulley, 705
Right Side Elevation, 709–710
School Bus, 711
Second Floor Plan, 707
Stamping #2, 697

drawing templates, 311. *See also* templates

drawing units, changing, 56–60

Drawing Units dialog box, 56–60

drawing window, 6

Annotation buttons, 6
Annotation Monitor, 6
Clean Screen, 6
closing, 32
Coordinates, 6
Customization, 6
Dynamic Input, 6
Grid Mode, 6
interactions, 7–12
Isolate Objects, 6
Isometric Drafting, 6
Model, 6
Object Snap, 6
Object Snap Tracking, 6
Ortho Mode, 6
Polar Tracking, 6
Snap Mode, 6
Workspace Switching, 6

drawings. *See also* documents

Grate, 32
model space, 12
new, 2–4
opening saved, 32
orientation, 163–164
paper space, 12
plotting, 80–81
saving, 31–32

DSETTINGS command, 53–54
DUCS (dynamic user coordinate system), 582–585
.dwt files, 3
Dynamic, 5
Dynamic Input, 6
Dynamic Input buttons, 20
dynamic input display, 9–10

E

EATTEDIT command, 500
editing
noun/verb method, 66, 67–68
verb/noun method, 66–67
Effects panel, 298
ELLIPSE command, 532–535
ellipses, orthographic views, 538–540
elliptical arcs, 540
Endpoint object snap, 225, 569–574
<Enter> key, 23
ERASE command, 28–29, 58, 66, 74
erasing lines, 28–29
<Esc> key, 23
EXPLODE command, 460, 511–512
Express Tools tab, 5
EXTEND command, 223, 240–242
extending objects, 240–242
External Manager, 483–484
external references, 483–487, 500–503
clipping, 502–503
editing in place, 502
reloading, 502
Source drawing, 484
Target, 485
EXTRUDE command, 665–666
extruding, 665–666

F

Fan Bezel drawing project, 92–93
Favorites tab, Blocks palette, 462
Featured Apps tab, 5
fields (tables)
inserting, 308–310
updating, 310–311
File hamburger button, 6
FILL command, 404–405
FILLET command, 101, 112, 405–408
fillets, 112–114
solid modeling, 593–594
fills, 404–405
gradient, 368–369
Find and Replace dialog box, 295
First Floor Plan drawing project, 706
Fixture Assembly drawing project, 552–553
Flange drawing project, 622–623
Flanged Bushing drawing project, 212–213, 690
Flanged Coupling drawing project, 554–555
Flanged Wheel drawing project, 384–385, 692
Floor Framing drawing project, 176–177
Fluid Sampler Schematic drawing project, 698
fonts, 296–298
freeze and thaw properties, 111
Front Elevation drawing project, 708
frustum cones, 637–638

G

Garage Framing drawing project, 556–557
Gasket drawing project, 96–97
Gauges drawing project, 318–319
Gazebo drawing project, 446–447
geometric constraints, 424–427
gizmos, 595–597
Globe drawing project, 686–687
gradient fill, 368–369
Grate drawing, 32–33

grid, 11
settings, 52
snap, 19
spacing, 52
zooming to center, 11–12
Grid, 5
Grid Mode, 6, 11, 20
Grid X spacing, 54–55
Grid Y spacing, 54–55
Grill drawing project, 170–171
Grip Edit, Rotate mode, 193
grips, 67
ARRAYRECT command, 156–159
COPY command, 152–153
mirror images, 201–202
MOVE command, 149–150
ROTATE command, 195–196
scaling with, 304–305
sectioning and, 642–645
stretching and, 246–247
Grooved Hub drawing project, 270–271, 691
GROUP command, 454–456
groups, 453–454
creating, 454–456
Groups panel, 6, 456
Guide drawing project, 38–39

H

Half Block drawing project, 134–135
Hatch and Gradient dialog box, 366
HATCH command, 364–369
hatching, 364–366
gradient fill, 368–369
patterns, 367–368
sections and, 645
heads-up design, 13
Hearth drawing project, 210–211
HELIX command, 669–670
helixes, 669–670
Help, 5
HELP command, 63–66
Home tab, 5
Annotation panel, 6
Block panel, 6
Clipboard panel, 6
Draw panel, 5
Groups panel, 6
Layers panel, 6
Modify panel, 5
Properties panel, 6
Utilities panel, 6
View panel, 6

I

icons, UCS, 6
in-canvas property review, 292
incremental snap, 19
Index color tab, 104–105
Index Guide drawing project, 220–221
Infer Constraints, 431
InfoCenter, 5
inscribed *versus* circumscribed, 638
Insert tab, 5
Insert Table dialog box, 306
Insert tool, blocks, 461–464
isocircles, 532–535
ISODRAFT tool, 526
Isolate Objects, 5, 6
Isometric Drafting, 5, 6
isometric drawings
boxes, 527
chamfers, 531–532
circles, 532–535
COPY command, 529–530
cross hairs, 528
grid, 527
isometric snap, 525–527
planes
switching, 527–529
text, 535–537

Isometric Projects drawing project, 548–549
Isometric Tracking, 20
isoplanes, 526
Items tab, 185

J

Jack Plane drawing project, 700–704
JOIN command, 248
justified text
aligned text, 285
centered, 284
dynamic input list, 285–286
Fit option, 285–286
left justified, 295
middle text, 284–285
multiline text, 293
right-justified, 283–284

K

keyboard
blocks, 459
command entry, 13–14
<Enter> key, 23
<Esc> key, 23
shortcuts, 731
KML (Keyhold Markup Language), 613
Knob drawing project, 386–387
Koch Snowflake drawing project, 326–327

L

Landscape orientation, 204
lassos, 72–74
Last option, 72
Layer Properties Manager palette, 102
colors, 104–106
layers, 103–104
line types, 106–107
lineweights, 108–109
regeneration, 111
Layer Properties tool, 102
layers, 101
alias, 102
color assignment, 104–106
creating, 102
current, changing, 109–111
deleting, 111
dimensions, 102
Layer Properties Manager palette, 103–104
panel, 102
tool, 102
Layers panel, 6, 110
Layers & View panel, 580–581
Layout hamburger button, 6
Layout tab, 6
layout tabs, 5
layouts, 140–141
creating, 251–261
model space, 253–254
modifying, 254–256
opening, 252–253
paper space, 253–254
viewports, 256–257
views, multiple, 615–619
Leader - Circle style tool, 355–356
leaders
multileaders, 352–354
tool palette, 354–359
Learning & Insights tab, 4
left-justified text, 295
legacy elements, CUI dialog box, 732
LENGTHEN command, 248
lights, solid modeling
geographic location, 613
point light, 611
spot light, 606–609
sunlight, 612–613
limits
model space, 140–141
new, 141–142
paper space, 140–141

LIMITS command, 141–142
LINE command, 33–34, 228, 529, 530, 722–727
linear dimensions, 334–339
multiple, 339–342
QDIM, 339–342
lines
erasing, 28–29
polylines, 115, 116
vertical, 184
linetypes
assigning, 106–108
scale, 111–112
Lineweight dialog box, 108–109
lineweights, 108
Link Design drawing project, 268–269
Link Mount drawing project, 624–625
LISP files, CUI dialog box, 732
LIST command, 460
lock/unlock settings, 111
LTSCALE command, 112

M

Mallet drawing project, 218–219
Manage tab, 5
MATCHPROP command, 300–302
Maximize button, 5
Maximize Viewport button, 260–261
MEASUREGEOM command, 223, 248–251
measuring objects, 248–251
menus
application menu, 5, 16–17
characters, CUI dialog box, 733
shortcut, 23–24, 731
mesh modeling, 645–647
Boolean operations, 653–656
converting to solids, 656–657
smoothing meshes, 651–652
subobjects, 647–650
middle text, 284–285
midstring AutoComplete, 15–16
Minimize button, 5, 17
Minimize Viewport button, 260–261
MIRROR command, 198–202
Mirror Grip Edit mode, 201–202
mirror images, 198–202
Mirror Mounting Plate drawing project, 396–397, 693
mode buttons, 6
Model, 6
model space, 5, 12, 140–141
dimensions, 369–372
switching between paper space, 253–254
Model tab, 6
Modify panel, 5
Mounting Plate drawing project, 126–127, 714
mouse, 7
buttons, 732
crosshairs, 7–8
right-click, 23–24
MOVE command, 146–149
displacements, 150
grips, 149–150
MP3 player drawing project, 550–551
MREDO command, 27
MTEXT command, 279, 288–289
Multi Wrench drawing project, 48–49
multifunctional grips, 156–159
multileaders, 352–354
multiline text, 288–289
justification, 293

N

Navigation bar, 5, 6
Navigation wheels, 5
New button, 2
drop-down list, 3
NEW command, 3
New Drawing, 5
New Layout, 5
New Text Style dialog box, 298–299

nonrectangular viewports, 379
Nose Adapter drawing project, 388–389, 692
noun/verb editing, 66, 67–68
NURBS (nonuniform rational B-spline), 414

O

object linking and embedding (OLE), 480
object selection, 68–69
Add option, 74
by crossing window, 70–71
lassos, 72–74
Last option, 72
Previous method, 72
Remove option, 74
Select Similar option, 74
undoing, 74
by window, 69–70
object selection window, 10
object snap, 75–77
Apparent Inter mode, 229
blocks, 463
Center mode, 229
Endpoint mode, 225, 229, 569–574
Extension mode, 229
Insertion mode, 229
Intersection mode, 227–228, 229
Midpoint mode, 227–228, 229
Nearest mode, 229
Node mode, 229
options, 229
Parallel mode, 229
Perpendicular mode, 229
point selection, 224–226
Quadrant mode, 229
running, point selection, 226–230
Tangent, 225
Tangent mode, 227–228, 229
wireframe models, 569–570
Object Snap, 5, 6
Object Snap buttons, 20
Object Snap shortcut menu, 225
Object Snap Tracking, 6, 20, 230–231
point acquisition, 231–235
objects
extending, 240–242
layers, making current, 110–111
measuring, 248–251
shortening, 237–240
Office Building drawing project, 448–449
Office Plan drawing project, 518–519
OFFSET command, 235–237
OLE (object linking and embedding), 480
online Help, 63–66
OOPS command, 67–68
Orbit, 5
ordinate dimensions
DIMORDINATE command, 342–347
QDIM and, 342–344
UCS command, 342–347
orientation, 203–204
Ortho mode, 6, 20, 29–30, 196–197
isometric drawings, 529–530
Ortho on/off, 5
orthographic views, ellipses, 538–540
arcs, 540
OSNAP command, 227
Outer Conductor drawing project, 716
Output tab, 5

P

Packing Flange drawing project, 136–137, 691
Page Setup dialog box, 203–206
Page Setup Manager, 203
page setups, 202–203
importing, 206
Page Setup dialog box, 203–205
Pan, 5
PAN command, 101, 118
Panel drawing project, 392–393
panning, scroll wheel, 118

paper size, 162
paper space, 12, 140–141
dimensions, 369–372
switching between model space, 253–254
parallel objects, OFFSET command, 235–237
parallel projection, 639–640
Parameter Manager tool, 474
parameters, dynamic blocks, 465
Parameters Manager, 429–431
parametric design, 423–424
AutoConstrain, 431–434
dimensional constraints, 427–429
geometric constraints, 424–427
Parameters Manager, 429–431
Parametric tab, 5
Passenger Locomotive drawing project, 712
PASTEBLOCK command, 482
PASTECLIP command, 482
path arrays, 416–418
Pattern panel, 367–368
patterns, hatching, 367–368
PEDIT command, 405–408, 411–413
pick button, mouse, 7
pick points, 458
Picnic Table drawing project, 628–629
Pivot Mount drawing project, 688–689
planes, isometric, text, 535–537
PLINE command, 400–402, 405–410
PLOT command, 33–34
Plot dialog box, 36, 81–84, 142
Add-a-Plotter Wizard, 162
drawing orientation, 163–164
Paper size panel, 162
Plot area panel, 164
Plot offset, 164
Printer/plotter panel, 161–162
Plot - Model dialog box, 34–35
Plot Plan drawing project, 390–391
Plot tool, 34–35
plotter pens, lineweights, 108
plotting, 34–35, 80–81
layouts (*See also* layouts)
multiple-viewport drawings, 261
plot area, 82
plot preview, 83–84
POINT command, 421–423
point filters, 568–569
Point Style dialog box, 422–423
points, 421–423
selecting, object snap, 224–226
Polar Array tool, 184
polar arrays, 154, 183–184
angles between, 186
rows, 185–186
polar coordinates, 21, 22–23
Polar tracking, 5, 6, 20, 29, 30, 196–198
POLYGON command, 400–401, 638–639
polygons, 400–402
polylines, 115, 116, 399
donuts, 402–404
editing, 411–413
fills, 404–405
path arrays and, 416–418
polygons, 400–402
segments
arcs, 408–410
straight, 405–408
vertex editing, 411–413
polysolids, tiled viewports, 632–635
Portrait orientation, 204
PRESSPULL command, 666–667
Previous method, 72
primitives, 577
cones, frustum cones, 637–638
pyramids, 638–639
torus, 639–640
Printed Circuit Board drawing project, 442–443
Printer/plotter panel, 161–162
printing, 34–35
printer selection, 81–82
properties
annotative, 372–373
in-canvas property review, 292
Quick Properties palette, 291–292
text, 291–292

Properties palette, 360–361
Properties panel, 6
Property Settings dialog box, 301
PSETUPIN command, 206
Pulley drawing project, 705
PURGE command, 460, 512–513
pyramids, 638–639

Q

QDIM, 339–342
ordinate dimensions, 342–344
QSAVE command, 31
QSELECT command, 458
quadrant object snap, 75–77
Quick Access toolbar, 5, 36
CUI dialog box, 730
MREDO command, 5
OPEN command, 5
PLOT command, 5
QNEW command, 5
QSAVE command, 5
SAVEAS command, 5
SHARE command, 5
U (Undo) command, 5
Quick Properties palette, 291–292, 360–361, 731
Quick Select dialog box, 458

R

Race Car drawing project, 444–445
radius, circle drawing, 58–60
radius diameter, 352
Recent tab, 4
RECTANG command, 77–79, 116
rectangular arrays, 154
REDO command, 27
references
external, 500–503
clipping, 502–503
editing in place, 502
reloading, 502
scaling by, 304
regeneration, 111
relative coordinates, @ symbol, 24
Remove option, 74
Render Presets Manager, 601–602
REVCLOUDARCVARIANCE, 421
revision clouds, 418–421
REVOLVE command, 667–669
Revolve Designs drawing project, 682–683
ribbon, 5, 17
Add-ins tab, 5
Annotate tab, 5
Collaborate tab, 5
CUI dialog box, 730
Express Tools tab, 5
Featured Apps tab, 5
Home tab, 5
Insert tab, 5
Manage tab, 5
Output tab, 5
Parametric tab, 5
View tab, 5
Ribbon panel, 5
custom panels, 717
creating, 718–720
custom tools, 721–727
text, 296–297
Ribbon tabs, 5
Right Side Elevation drawing project, 709–710
right-click mouse button, 23–24
right-justified text, 283–284
ROTATE command, 193–195
Rotate Items function, 185–186
rotating, 193
base point, 196
coordinate system, 194

grips, 195–196
Polar tracking, 196–198
Reference option, 194
rotation cursor, 659–662
rounds, 112
rows, polar arrays, 185–186
rubber band, 21
running object snap, point selection, 226–230

S

SAVE command, 31–32
Save Drawing As dialog box, 31–32, 144–145
SAVEAS command, 31–32
scale, linetypes, 111–112
SCALE command, 304
scaling, 302–304
base point, 303
dimensions
model space and, 369–372
paper space and, 369–372
with grips, 304–305
by reference, 304
School Bus drawing project, 711
Scooter Assembly drawing project, 523
scroll wheel
panning, 118
zooming, 117
Search, 5
Second Floor Plan drawing project, 707
sectioning solids, 641–645
segments, polylines
arcs, 408–410
straight, 405–408
Select Reference File dialog box, 485
Select Similar option, 74
Select template dialog box, 140–141
selection. *See also* object selection
points, object snap, 224–226
Sheet Metal Stamping drawing project, 98–99
Shim drawing project, 42–43
shortcut menus, 23–24
CUI dialog box, 731
ShowMotion, 5
single-line text, 122–123
justification
aligned text, 285
centered text, 284
dynamic input list, 285–286
Fit option, 285–286
middle text, 284–285
right-justified, 283–284
SLICE command, 640–641
Slotted Flange drawing project, 272–273, 692
Snap, 5
borders, 312
grid, 19
incremental, 19
isometric snap, 525–527
settings, 52–55
Snap and Grid tab, 54
Snap Mode, 6, 19–20
Snap X spacing, 54–55
Snap Y spacing, 54–55
solid modeling, 575–576
Boolean operations, 576–577, 653–656
chamfers, 590–593
composite solids, 585–591
DUCS (dynamic user coordinate system), 582–585
fillets, 593–594
gizmos, 595–597
lights
geographic location, 613
Lights in Model palette, 609–610
point light, 611
spot light, 606–609
sunlight, 612–613
mesh modeling, 645–647
Boolean operations, 653–656
converting to solids, 656–657
smoothing meshes, 651–652
subobjects, 645–647
polysolids, tiled viewports, 632–635

primitives, 577
cones, 636–638
pyramids, 638–639
torus, 639–640
sectioning solids, 641–642
grips and, 642–645
slicing solids, 640–641
SUBRACT, 585–591
UNION, 581–582
visual styles, 580–581
spacebar, 23
special characters, 288
Specify start point prompt, 281
spell check, 294–295
SPELL command, 294–295
SPLINE command, 414–416
SPLINEDIT command, 416
splines, 414–415
editing, 416
path arrays and, 416–418
tangency, 415
Sprocket drawing project, 264–265
Stamp drawing project, 44–45
Stamping #2 drawing project, 697
Stamping drawing project, 320–321
Start tab, 2–4
New button, 2
status bar, 6
Dynamic Input buttons, 20
Grid Mode, 20
Isometric Tracking, 20
Object Snap buttons, 20
Object Snap Tracking, 20
Ortho Mode, 20
Polar Tracking, 20
Snap Mode, 20
Status bar, 5
Stay Connected, 5
Stepped Shaft drawing project, 128, 690
STRETCH command, 150, 223, 242–248
subobjects, 645–647
SWEEP command, 670–671

T

Table tool, 305–306
tables, 305–306
Appearance column, 308
entering data, 307
fields
inserting, 308–310
updating, 310–311
Format column, 308
insertion point, 307
tabs
Add-ins tab, 5
Annotate tab, 5
Collaborate tab, 5
drawing file tabs, 6
Express Tools tab, 5
Featured Apps tab, 5
Home tab, 5
Insert tab, 5
Items, 185
Layout tab, 6
Manage tab, 5
Model tab, 6
Output tab, 5
Parametric tab, 5
Snap and Grid, 54
View tab, 5
tangency, 415
tangent object snap, 75–77
Tangent snap, 225
Tapered Bushing drawing project, 684–685
target location 3D walkthrough, 672–673
Template drawing project, 132–133
Template folder, 330
templates, 2–3
acad.dwt, 3
borders, 312
browsing, 3
creating, 143–144
.dwt files, 3
saving, 144–146
Template folder, 330

Test Bracket drawing project, 174–175, 691
text
alignment, isometric planes, 535–537
angled, 286–287
Annotative style, 296–297
dimension text, 359–361
editing in place, 290–291
FIND command, 294–295
fonts, 296–298
model space, 370–372
multiline, 280, 288–289
paper space, 370–372
properties, 291–292
MATCHPROP command, 300–302
Ribbon panels, 296–297
scaling, 302–305
single-line, 122–123
justification and, 279–285
special characters, 288
Specify start point prompt, 281
SPELL command, 294–295
styles, 296
switching, 299
TEXT command, 279
Text Editor tab, 307
Text panel, 280
TEXTALIGN command, 282
TEXTEDIT command, 290–291
tiled viewports, 632–635
Tiles drawing project, 46–47
Title Block drawing project, 316–317
Tool Block drawing project, 276–277, 382–383, 692
tool palettes, leaders, 354–359
Tool Palettes window, 354–355
toolbars
CUI dialog box, 730–731
Quick Access, 36
Quick Access toolbar, 5
tooltips, 17–19
torus, 639–640
Tracking, 5
transparency, 14
TRIM command, 223, 237–240, 533–534
Trim mode, 114–115
True Color color model, 104–105

U

U command, 27–28
UCS (user coordinate system), 8, 567
3D coordinates, 567–568
defining, 570–574
UCS command, 342–347
UCS icon, 6, 8
Undo command, 27–28
Undo tool, 27–28
UNION command, 581–582
units, decimal, 57
USC icon, 5
Utilities panel, 6

V

Valve drawing project, 560–561
verb/noun editing, 66–67
vertex editing, 411–413
vertical line, 184
VIEW command, 541–544
View control, 5
View Manager dialog box, 542–544, 565–567, 604–605
View panel, 6
View tab, 5
ViewCube, 5, 6, 640
viewpoint changes, 613–615
viewpoints
3D Orbit tools, 658–664
camera position, 659
changing, 565–367
Continuous Orbit, 663–664
Preset View, 662
Reset View, 662
ViewCube, 613–615

Visual Aids, 662–663
Visual Styles, 662–663
Viewport Configuration dialog box, 632–635
Viewport controls, 5
viewports
borders, 378
creating, 256–257
Maximize Viewport button, 260–261
Minimize Viewport button, 260–261
multiple-viewport drawings, 261
nonrectangular, 379
tiled, 632–635
views, saved, 541–544
Visual Style control, 5
visual styles, 580–581
VPCLIP command, 379

W

Wall Framing drawing project, 178–179
WBLOCK command, 460
WCS (world coordinate system), 564, 570–571
Weave drawing project, 172–173
WEDGE command, 579–580
windows
application window, 4–5
closing, 6
drawing window, 6
closing, 32
object selection window, 10, 69–70
Windows Clipboard. *See* Clipboard
wireframe models, 564
3D coordinates, 567–568
object snap, 569–570
plan view, 565
point filters, 568–569
viewpoints, changing, 565–367
Workspace Switching, 5, 6
Workspace Switching tool, 4
workspaces, 4
3D Basics, 4
3D Modeling, 4
CUI dialog box, 730
customizing, 79–80
Drafting & Annotation, 4

X–Y–Z

XOPEN command, 494–495
XP zoom, 257–260
xrefs, 454
Zoom, 5
ZOOM command, 11–12, 101, 257–260
All option, 121
Extents option, 118–119
Previous option, 121
Window option, 119–121
zooming
center grid, 11–12
scroll wheel, 117
XP zoom, 257–260